

District Video Log Review: Conducted by FHWA FL-Div and FDOT CO

District	Population Size	Sample Size	Confidence Level	Margin of Error	Percent Correct	-Mrgn of Error	+Mrgn of Error
4	5247	358	95%	5.0%	78.9%	73.9%	83.9%

District 4 has a population of 5247 unique sidewalk segments (1449.1 miles) with a sample size of 358 sidewalks segments (100.9 miles). We are 95% confident that all of District 4 is between 73.9% and 83.9% correct.

S/W Segment Miles

100.9

Percent Compliant	
96.4%	78.9%

"Verified?" Column indicates use of Google Maps Street View for updated images. Y – verified; N – could not verify; N/A did not need to verify.

images. Y – verified; N – could not verify; N/A did not need to verify.

#	RDWYID	BMP	EMP	NET	SIDE	SDWLKL		SDWLKR		Curb Ramp	DWS	Traffic Signal	Ped Signal	APS	Compliant ?	Comments/Notes	D4 Comments	Ops Center	Corrective Action Plan
						Width	Slidtype	Width	Slidtype										
20	86014000	9.766	9.884	0.118	L	6	Raised			Y	N	Y	Y	N	N	Good example of furniture and frontage zones that allow continuous PAR. However, the red DW surface do not seem to contrast with the surrounding area, even when checked on google. District or QAR team should check to ensure the DW is usable/accessible.		Broward	D4 DESIGN OFFICE WILL HANDLE COORDINATION WITH LOCAL AGENCY
25	86018000	1.029	2.525	1.496	L	6				Y	Y	Y	Y	N	N	Pembroke Road at SR7 - active construction in VL shows break in PAR near the Kia dealership (Google shows a fully reconstructed intersection with no obstructions or break in PAR). Sample ends at SW72 Ave. Sidewalks are in generally good shape with evidence of regular maintenance. As with many of the longer samples, there are numerous instances of driveway aprons without level walkarounds and ped button placement on utility poles regardless of whether walking surface is level. Issues that require site visit: 1) On street parking at 2.249 has a DW mat that lacks useful message and it isn't clear if the ramp at this location has level maneuvering space at the top. 2) Ped Buttons on the northeast and northwest corners of Pembroke and SW 64th Ave (mp 2.034) appear high above the walking surface. Could not validate with google. Need to be checked for reach ranges. 3) Another handicapped parking space at mp 1.994 has a DW with no visible purpose. 4) At mp 1.524 a utility pole blocks the PAR with a raised curb on the left and an asphalt drive (with a parked car) on the right. Tried to validate but google image is confusing - active or planned work?		Broward	FIELD VERIFY. RAMP DOESN'T MEET 4" ADA LANDING. RECOMMEND TO SENT TO D4 DESIGN OFFICE FOR RECONSTRUCTION. DESIGN WILL COORDATE WITH MAININTG AGENCY IF SECOND PED BUTTON IS FEASIBLE TO INSTALL
28	86020000	3.098	3.342	0.244	L	7	Raised			Y	N	Y	Y	N	N	US1/SR5/Sunrise Blvd at mp 3.260 - bus stop sign and bench create a possible pinch point. Google suggests ample space between the two features. This segment has numerous signed stops at entrances to large retail facilities. Most have no DW surface at all and a couple have older grid or slash style DW stamps. Could no verify via google. Recommend site visit.		Broward	REQUEST SENT TO DISTRICT MAINTENANCE FOR ASSET MAINTENANCE TO REPAIR (E4T63 LOUIS BERGER)
29	86020000	9.612	10.043	0.431	L	8	Raised			Y	N	n/a	n/a	n/a	N	Exceptionally wide PAR, F/S/SR with an adjacent multi-use asphalt path. Possible issues at US1 at NE 12 St. Sidewalk and Multi-use path cross 12th with a median. Median lacks DW mats in contrasting color but appear to still be tactile. The south side of the intersection has a DW surface that could not be validated, even with google. Neither side of the multi-use path has a DW. The Google validation is not as old as the VL, but still several years old. Recommend site visit.	Repairs to be completed by March 2023	Broward	Repair complete 9/14/22
59	86050000	11.345	11.409	0.064	L	10	Raised			Y	N	Y	Y	N	N	A1A at Canal Drive appears to lack DWS. Checked Google but that image is from 2015 and even older than the VL at Canal Drive. Need to have D4 take a look?		Broward	Repair complete 9/22/22
62	86065000	9.247	9.295	0.048	R	6	Raised			Y	Y	Y	Y	N	N	On Powerline and NW 32nd street, utility poles in the middle of the PAR may narrow path to less than 32" - could not validate any improvements by using Google Maps.		Broward	NO FEASIBLE CORRECTIVE ACTION PLAN AT THIS TIME.
158	88070000	6.646	7.074	0.428	L	8	flush			Y	N	n/a	n/a	n/a	N	On SR-A1A, ramps missing DWS or the surface have lost tactility. Google image is from 2019 but shows no DWS.		Treasure Coast	TCOps sidewalk contractor to repair through work order by march 2023
166	89010000	14.650	14.707	0.057	L	5	flush			Y	N	n/a	n/a	n/a	N	On Federal Highway at Sunshine Manor - cannot see DWS on VL or google. MP for intersection is 14.678 MP.		Treasure Coast	TCOps sidewalk contractor to repair through work order by march 2023
172	89030000	0.175	1.141	0.966	R	4	curb			n	n	n	n/a	n/a	n	Specified MP range not in viewer. Reviewed comparable length from BMP=26.600 to EMP=27.600. MP=26.6 (roundabout) - DWS missing from Median Ped Refuge Island (MPRI) on south leg and crosswalk; DWS missing on Jensen Bch Causeway (EB) leg MPRI, too. MP=26.740 - at Parking Area, curb returns may not align well with crossing direction. MP=26.845 - drop curb width not equal to s/w width (>= 5)? TDA data shows width = 4'.		Treasure Coast	TCOps sidewalk contractor to repair through work order Or via asset maintenance contractor by March 2023
178	89030000	15.78	16.214	0.434	R	6	flush			n/a	n	n	n/a	n/a	n	Reviewed A1A NB Left Side from roundabout at Jensen Beach Park, for "0.5 miles to St. Lucie Co. line. Missing or non-compliant DWS at (1) Island Shoppes - The Gin Mill?	All Treasure Coast repairs will be completed by June 2023	Treasure Coast	TCOps sidewalk contractor to repair through work order Or via asset maintenance contractor by March 2023
179	89030000	18.147	18.296	0.149	R	6	flush			n/a	y	n	n/a	n/a	n	Reviewed A1A NB both sides from St. Lucie Co. line to "Kyle G's - Prime Seafood & Steaks" (~0.2 miles). D/w splitter island reduces unobstructed s/w width at Signed Entrance to "11000 Villa Del Sol."		Treasure Coast	TCOps sidewalk contractor to repair through work order Or via asset maintenance contractor by March 2023
199	89530000	1.716	2.213	0.497	L	7	curb			y	n	y	y	n/a	n	MP=1.922 & 1.967 - d/w with stop sign missing DWS.		Treasure Coast	TCOps sidewalk contractor to repair through work order Or via asset maintenance contractor by March 2023
208	93001000	4.786	4.883	0.097	R	6	curb			y	n	n	n/a	n/a	n	MP=4.875 - Missing or non-compliant DWS at stop-controlled intersection?		Palm Beach	Suitable contract will found to complete repairs by end of FY 23
210	93001000	8.133	8.275	0.142	R	8	curb			y	n	n	n/a	n/a	n	MP = 8.135,8.200 - Missing or non-compliant DWS at stop-controlled intersection?		Palm Beach	Will be repaired by Assett Maint. Contract #E4T63/PM-Salvato by march 2023
214	93006000	2.025	5.459	3.434	L	7	curb			y	n	y	y	n/a	n	MP=2.477, 2.522, 2.577, 2.652, 2.747, 2.787, 2.837, 2.862, 2.897, 3.012, 3.067, 3.687, 3.742, 3.932, 4.082, 4.212, 4.482, 4.517, 4.712, 4.782, 4.887, 4.917, 5.247, 5.312, 5.347 - Missing or non-compliant DWS at stop-controlled intersection?		Palm Beach	Suitable contract will found to complete repairs by end of FY 23
215	93006000	4.385	5.648	1.263	R	7	curb			y	n	y	y	n/a	n	MP=4.455, 4.510, 4.570, 4.855, 5.070, 5.305, 5.360, 5.370, 5.410, 5.625 - Missing or non-compliant DWS at stop-controlled intersection?		Palm Beach	Suitable contract will found to complete repairs by end of FY 23
218	93010000	1.24	1.364	0.124	L	7	curb			n/a	n	n	n/a	n/a	n	MP= 1.302 - Missing or non-compliant DWS at stop-controlled intersection?		Palm Beach	Will be repaired by Assett Maint. Contract #E4T63/PM-Salvato by march 2023
219	93010000	2.882	3.145	0.263	L	7	curb			y	n	y	y	n/a	n	MP= 3.067 - DWS at curbed bus stop may not be required? MP= 2.907, 2.937 - water ponding obstructing s/w thru Marathon gas station d/w?		Palm Beach	Will be repaired by Assett Maint. Contract #E4T63/PM-Salvato by march 2023
221	93010000	5.677	5.842	0.165	R	5	flush			n/a	n	n	n/a	n/a	n	MP=5.790 - missing DWS on one end of crossing of Enfield Stree? MP= 5.815, 5.845 - Missing or non-compliant DWS at stop-controlled intersection?		Palm Beach	Will be repaired by Assett Maint. Contract #E4T63/PM-Salvato by march 2023
223	93010000	6.175	6.316	0.141	L	7	flush			n/a	n	n	n/a	n/a	n	MP= 6.152 - Missing or non-compliant DWS at stop-controlled intersection?		Palm Beach	Will be repaired by Assett Maint. Contract #E4T63/PM-Salvato by march 2023
224	93010000	7.3	7.409	0.109	L	6	flush			n/a	n	n	n/a	n/a	n	MP=7.387 - DWS provided for crossing US-1, but appears crossing is not intended here?		Palm Beach	Will be repaired by Assett Maint. Contract #E4T63/PM-Salvato by march 2023

#	RDWYID	BMP	EMP	NET	SIDE	SDWLKL		SDWLKR		Curb Ramp	DWS	Traffic Signal	Ped Signal	APS	Compliant ?	Comments/Notes	D4 Comments	Ops Center	Corrective Action Plan
						Width	Shldtype	Width	Shldtype										
227	93010000	7.906	8.276	0.37	R			6	curb	y	n	y	y	n/a	n	MP= 8.195 - Missing or non-compliant DWS at stop-controlled intersection?		Palm Beach	Will be repaired by Assett Maint. Contract #E4T63/PM-Salvato by march 2023
228	93010000	8.977	9.1	0.123	R			7	curb	y	n	n	n/a	n/a	n	MP= 9.060 - Missing or non-compliant DWS at stop-controlled intersection?		Palm Beach	Will be repaired by Assett Maint. Contract #E4T63/PM-Salvato by march 2023
231	93010000	10.505	10.56	0.055	L	6	curb			n/a	n	n	n/a	n/a	n	Specified MP range not in viewer. Reviewed comparable length from BMP=10.817 to EMP=10.872. MP= 10.819, 10.864 - DWS Missing or non-compliant DWS at stop-controlled intersection?		Palm Beach	Will be repaired by Assett Maint. Contract #E4T63/PM-Salvato by march 2023
232	93010000	10.836	11.234	0.398	R			4	curb	y	y	y	y	n/a	n	S/w flagged as less than 5' wide.		Palm Beach	Will be repaired by Assett Maint. Contract #E4T63/PM-Salvato by march 2023
233	93010000	13.54	14.148	0.608	L	4	curb			y	n	y	y	n/a	n	S/w flagged as less than 5' wide, but Google confirms it has been replaced with a wide sidewalk MP= 13.674, 13.729, 13.779, 13.829, 14.079 - Missing or non-compliant DWS at stop-controlled intersection? MP 13.629 - walking surface failure at drainage inlet protected by single orange cone (evidenced in Google). MP= 13.554 - Missing or non-compliant DWS at stop-controlled intersection?		Palm Beach	Will be repaired by Assett Maint. Contract #E4T63/PM-Salvato by march 2023
234	93010000	14.412	14.514	0.102	R			5	curb	y	n	y	y	n/a	n	MP= 14.525 - Missing or non-compliant DWS at stop-controlled intersection?		Palm Beach	Will be repaired by Assett Maint. Contract #E4T63/PM-Salvato by march 2023
236	93010101	1.76	1.854	0.094	R			6	curb	y	n	n	n/a	n/a	n	Specified MP range not in viewer for NB direction. Substitute SB direction. MP= 1.780 (Rub A Dub Car Wash) - Missing or non-compliant DWS at stop-controlled intersection?		Palm Beach	Will be repaired by Assett Maint. Contract #E4T63/PM-Salvato by march 2023
240	93016000	6.739	6.811	0.072	R			6	curb	y	n	n	n/a	n/a	n	MP= 6.789 - Missing or non-compliant DWS at stop-controlled intersection?		Palm Beach	
241	93016000	8.269	8.321	0.052	L	5	mix			y	n	n	n/a	n/a	n	MP= 8.329 - DWS doesn't appear to be 4' min. behind the traffic gate?		Palm Beach	
244	93016000	8.537	8.739	0.202	L	5	curb			y	n	y	y	n/a	n	MP= 8.724 - DWS doesn't extend full width of drop curb?		Palm Beach	
245	93020000	7.551	7.694	0.143	R			6	curb	y	n	y	y	n/a	n	Specified MP range not in viewer. Use comparable range BMP=9.110 to EMP=9.253. MP= 9.232 - DWS insufficient (doesn't extend full width of ramp) at Dixie Hwy and PB Lakes Blvd.		Palm Beach	Will be repaired by Assett Maint. Contract #E4T63/PM-Salvato by march 2023
250	93020001	2.099	2.289	0.19	L	7				y	n	y	y	n/a	n	MP= 2.113, 2.163, 2.208, 2.258 - DWS not sufficient (full width)?		Palm Beach	Will be repaired by Assett Maint. Contract #E4T63/PM-Salvato by march 2023
254	93030000	8.212	8.28	0.068	L	5	curb			y	n	y	y	n/a	n	MP=8.270 - DWS missing from East end of crossing at Swinton Ave?		Palm Beach	Suitable contract will found to complete repairs by end of FY 23
257	93040000	0.559	0.613	0.054	R			6	curb	y	n	y	y	n/a	n	MP= 0.580 - DWS missing at stop-controlled d/w (Walgreens).		Palm Beach	Will be repaired by Assett Maint. Contract #E4T63/PM-Salvato by march 2023
262	93050000	1.151	1.3	0.149	L	7	curb			y	n	y	y	n/a	n	MP= 1.300 - Missing or non-compliant DWS at stop-controlled intersection?		Palm Beach	Will be repaired by Assett Maint. Contract #E4T63/PM-Salvato by march 2023
263	93050000	1.151	1.3	0.149	R			7	curb	y	n	y	y	n/a	n	MP= 1.185 - Missing or non-compliant DWS at stop-controlled intersection?		Palm Beach	Will be repaired by Assett Maint. Contract #E4T63/PM-Salvato by march 2023
264	93050000	1.3	1.482	0.182	R			7	curb	y	n	n	n/a	n/a	n	MP= 1.275, 1.295, 1.36, 1.445 - Missing or non-compliant DWS at stop-controlled intersection?		Palm Beach	Will be repaired by Assett Maint. Contract #E4T63/PM-Salvato by march 2023
265	93050000	4.721	4.839	0.118	R			7	curb	y	n	n	n/a	n/a	n	MP= 4.705, 4.760, 4.810 - Missing or non-compliant DWS at stop-controlled intersection?		Palm Beach	Will be repaired by Assett Maint. Contract #E4T63/PM-Salvato by march 2023
269	93060000	6.37	6.411	0.041	L	5	mix			y	n	n	n/a	n/a	n	MP= 6.435 - Missing or non-compliant DWS at stop-controlled intersection?		Palm Beach	Will be repaired by Assett Maint. Contract #E4T63/PM-Salvato by march 2023
272	93060000	9.298	9.666	0.368	L	7	curb			y	n	n	n/a	n/a	n	MP= 9.645 - Missing or non-compliant DWS at stop-controlled intersection? MP= 9.435, 9.470 - non-compliant DWS and pole in middle of s/w?		Palm Beach	Will be repaired by Assett Maint. Contract #E4T63/PM-Salvato by march 2023
274	93060000	14.329	14.41	0.081	L	5	flush			n/a	n	y	y	n/a	n	MP= 14.410 - Missing or non-compliant DWS at stop-controlled intersection?		Palm Beach	Will be repaired by Assett Maint. Contract #E4T63/PM-Salvato by march 2023
278	93060000	27.354	27.548	0.194	L	5	curb			y	n			n/a	n	MP=27.345, 27.430, 27.470 - Missing or non-compliant DWS at stop-controlled intersection?		Palm Beach	Will be repaired by Assett Maint. Contract #E4T63/PM-Salvato by march 2023
280	93070000	1.03	2.943	1.913	R			6	curb	y	n	y	y	n/a	n	Specified MP range not in viewer. Use comparable range BMP=1.539 to EMP3.452. MP=1.784, 1.899, 1.959, 2.009, 2.264, 2.439, 2.584, 2.664, 2.489?, 3.239, 3.399 - Missing or non-compliant DWS at stop-controlled intersection?		Palm Beach	Suitable contract will found to complete repairs by end of FY 23
285	93080000	0.877	0.887	0.01	L	7	curb			y	y	y	y	n/a	n	MP=0.857 - Missing or non-compliant DWS at stop-controlled intersection?		Palm Beach	Will be repaired by Assett Maint. Contract #E4T63/PM-Salvato by march 2023
286	93080000	5.04	5.085	0.045	R			5	flush	n/a	n	n	n/a	n/a	n	MP= 5.075 - Missing or non-compliant DWS at stop-controlled intersection?		Palm Beach	Will be repaired by Assett Maint. Contract #E4T63/PM-Salvato by march 2023
288	93090000	8.81	8.992	0.182	R			8	curb	y	n	n	n/a	n/a	n	MP= 8.904 - Missing or non-compliant DWS at stop-controlled intersection?		Palm Beach	Suitable contract will found to complete repairs by end of FY 23
290	93100000	12.368	12.53	0.162	L	6	curb			y	n	n	n/a	n/a	n	MP=12.469 - Missing or non-compliant DWS at stop-controlled intersection?		Palm Beach	Will be repaired by Assett Maint. Contract #E4V71/PM-Torres by march 2023
294	93120000	12.034	12.739	0.705	L	6				y	n	y	y	n/a	n	MP= 12.415, 12.689 - Missing or non-compliant DWS at stop-controlled intersection?		Palm Beach	Will be repaired by Assett Maint. Contract #E4V71/PM-Torres by march 2023
297	93130000	9.602	9.74	0.138	L	5	flush			n/a	n	n	n/a	n/a	n	MP= 9.605, 9.780 - Missing or non-compliant DWS at stop-controlled intersection?		Palm Beach	Will be repaired by Assett Maint. Contract #E4V71/PM-Torres by march 2023
302	93150000	14.148	14.253	0.105	L	6	curb			y	n	y	y	n/a	n	Specified MP range not in viewer. Use comparable range BMP=10.986 to EMP=11.070. MP= 10.995 - Missing or non-compliant DWS at stop-controlled intersection?		Palm Beach	Suitable contract will found to complete repairs by end of FY 23
310	93180001	0.138	0.339	0.201	L	5	curb			y	n	n	n/a	n/a	n	MP=0.135, 0.210, 0.265, 0.330 -Missing or non-compliant DWS at stop-controlled intersection?		Palm Beach	Will be repaired by Assett Maint. Contract #E4V71/PM-Torres by march 2023
318	93280001	0	0.205	0.205	L	7	curb			y	n	y	y	n/a	n	MP=0.000, 0.105 - Missing or non-compliant DWS at stop-controlled intersection?		Palm Beach	Will be repaired by Assett Maint. Contract #E4V71/PM-Torres by march 2023
320	93280001	0.484	0.522	0.038	R			6	curb	y	n	y	y	n/a	n	MP=0.513 - Missing or non-compliant DWS at signalized intersection.		Palm Beach	Suitable contract will found to complete repairs by end of FY 23
321	93290000	10.811	11.972	1.161	L	5	curb			y	n	n	n/a	n/a	n	MP=11.792, 11.887, 11.907, 11.927 - Missing or non-compliant DWS at stop-controlled intersection. MP=11.747-10.811 (actually extends much further; utility poles systematically reduce the useable width of the sidewalk).		Palm Beach	Will be repaired by Assett Maint. Contract #E4V71/PM-Torres by march 2023
322	93310000	22.479	22.737	0.258	L	6	curb			y	n	n	n/a	n/a	n	MP22.580 - Missing or Non-compliant DWS at stop-controlled intersection.		Palm Beach	Suitable contract will found to complete repairs by end of FY 23
323	93650000	1.142	1.244	0.102	L	5	curb			n/a	n/a	n	n/a	n/a	n	MP=1.207 - Useable sidewalk appears to be reduced by bench next to bus stop shelter?		Palm Beach	Off System - Local agency notified

#	RDWYID	BMP	EMP	NET	SIDE	SDWLK		SDWLKR		Curb Ramp	DWS	Traffic Signal	Ped Signal	APS	Compliant ?	Comments/Notes	D4 Comments	Ops Center	Corrective Action Plan
						Width	Slidetype	Width	Slidetype										
326	94003000	7.996	8.159	0.163	R			4	flush	n/a	n	n	n/a	n/a	n	S/w flagged as less than 5'. MP=8.155 - DWS not advised at d/w with no stop-control?		Treasure Coast	TCOps sidewalk contractor to repair through work order by March 2023
327	94005000	0.008	2.504	2.496	R			5	curb	y	n	y	y	n/a	n	MP=0.000, 0.210, 0400, 2.440 - Missing or non-compliant DWS at stop-controlled intersection?		Treasure Coast	TCOps sidewalk contractor to repair through work order by March 2023 Mile Post 0.00 will be addressed under upcoming construction project
328	94006000	0	0.407	0.407	R			6	curb	y	n	n	n/a	n/a	n	MP=0.475 - Missing or non-compliant DWS at stop-controlled intersection?		Treasure Coast	TCOps sidewalk contractor to repair through work order Or via asset maintenance contractor by March 2023
330	94010000	0.046	0.695	0.649	R			6	curb	y	n	y	y	n/a	n	MP=0.138 - Missing or non-compliant DWS at stop-controlled intersection?		Treasure Coast	TCOps sidewalk contractor to repair through work order Or via asset maintenance contractor by March 2023
331	94010000	0.695	0.852	0.157	R			5	curb	y	n	y	y	n/a	n	MP=0.673 - Missing or non-compliant DWS at stop-controlled intersection?	All Treasure Coast repairs will be completed by June 2023	Treasure Coast	TCOps sidewalk contractor to repair through work order Or via asset maintenance contractor by March 2023
332	94010000	3.232	3.43	0.198	L	5	curb		y	n	y	y	n/a	n	MP=3.415 - Missing or non-compliant DWS at stop-controlled intersection?	Treasure Coast		TCOps sidewalk contractor to repair through work order Or via asset maintenance contractor by March 2023	
333	94010000	7.749	8.403	0.654	R			5	curb	y	n	n	n/a	n/a	n	MP=7.773, 7.833, 8.108, 8.138, 8.198 - Missing or non-compliant DWS at stop-controlled intersection?		Treasure Coast	TCOps sidewalk contractor to repair through work order Or via asset maintenance contractor by March 2023
349	94120000	1.183	1.31	0.127	R			6	curb	y	n	y	y	n/a	n	MP=1.185, 1.260, 1.305 - Missing or non-compliant DWS at stop-controlled intersection?		Treasure Coast	Off - system, Local agency will be notified
350	94120000	1.636	1.819	0.183	L	6			y	n	y	y	y	n/a	n	MP=1.476, 1.766 - Missing or non-compliant DWS at stop-controlled intersection?		Treasure Coast	Off - system, Local agency will be notified
351	94120000	3.415	4.931	1.516	R			6	curb	y	n	y	y	n/a	n	MP=3.465, 3.575 - Missing or non-compliant DWS at stop-controlled intersection?		Treasure Coast	Off - system, Local agency will be notified
354	94120000	7.352	9.271	1.919	L	6	curb		y	n	y	y	y	n/a	n	MP=8.266, 8.511, 8.616 - Missing or non-compliant DWS at stop-controlled intersection?		Treasure Coast	TCOps sidewalk contractor to repair through work order
356	94504000	2.453	3.054	0.601	R			6	curb	y	n	y	y	n/a	n	MP=2.590, 2.730, 2.890, 3.050 - Missing or non-compliant DWS at stop-controlled intersection?		Treasure Coast	Off - system, Local agency will be notified

Percent Compliant					
S/W Miles	SDWLK	Curb Ramp	DWS	Ped Signal	Compliant ?
100.9	96.4%	96.4%	80.3%	96.1%	78.9%
	# compliant rows	347	347	289	346
	total # rows	360	360	360	360

District Video Log Review: Conducted by FHWA FL-Div and FDOT CO

District	Population Size	Sample Size	Confidence Level	Margin of Error	Percent Correct	-Mrgn of Error	+Mrgn of Error	
6	1943	321	95%	5.0%	82.7%	77.7%	87.7%	District 6 has a population of 1943 unique sidewalk segments (667.3 miles) with a sample size of 321 sidewalks segments (108.3 miles). We are 95% confident that all of District 6 is between 77.7% and 87.7% correct.

#	RDWYID	BMP	EMP	NET	SIDE	SDWLKL	Percent Compliant							Review Date	Compliant	Verifi	Comments/Notes	D6 Notes	Corrective Action Plan
							98.5%	98.8%	83.3%	Traffic	Ped	APS	82.7%						
							SDWLKR	Curb	DWS										
				108.3															
																		"Verified?" Column indicates use of Google Maps Street View for updated images. Y – verified; N – could not verify; N/A did not need to verify. S/F/SR = Stable/Firm/Slip-Resistant.	
25	87008001	0.209	0.355	0.146	R		5	Raised	Y	Y	n/a	n/a	n/a	7/27/2021	Y	N	SR 916 near NW 4th PC. Recent resurfacing project that appears to have included reconstruction of not just ramps but sidewalks as well. However, there are utility poles at mp .345 (near I-95) that may narrow the path of travel. It is difficult to determine using VL and Google. Recommend a site visit.	Disagree. Per field review the two light poles are compliant. Please see attached pictures Item 25 & 26 for reference.	Not needed.
26	87008001	0.355	0.533	0.178	R		6	Raised	Y	Y	Y	Y	N	7/27/2021	Y	N	Same location, just closer to I-95. Again, utility poles and traffic make it difficult to determine width of sidewalk at mp .385. Google was better than VL but neither definitive. Similarly, there is a mast arm at the off ramp that appears to bisect the PAR in half. Is there enough room on or the other side? Recommend site visit. Sample nds at the intersection with NW 7 Ave.	Disagree. Per field review sufficient ADA width is provided. Please see attached pictures Item 25 & 26 for reference.	Not needed.
28	87012000	0	0.839	0.839	L	5	Flush		N	N	N	N	N	9/14/2021	Y	N	NW 47th Ave/SR 847 and NW 185 Terrace lack ramps (or paved transitions) and DWS. At mp .189 there appears to be an excessive cross slope at the driveway gate that is exacerbated by drainage issues. Neither Google nor LV are entirely clear, but is the fence/gate taking part of the ROW? No paired curb ramps or transitions with DWS at NW 188th (mp .329). Google image is a bit old (2019). Entire stretch has multiple examples of parked cars, garbage cans and trash piles blocking the path of travel. Dec 2020 Google image shows the intersection at 191st St. under construction... possible that missing ped buttons were replaced and DWS added. They are both missing in the VL. At 192th, Google shows an attempt to add asphalt ramps, but likely as drainage as there are grates in the middle of each. To make matters worse, the grates are oriented with the path of travel. At 194th (mp .704) there are no paired ramps or flush transitions with DWS. Google shows the same condition but as of 2019. Hopefully, the active project in 12/2020 address all of these intersections. At 195th there are flush transition or ramps of a sort, but they lack DWS. Google shows active work on the other side of the street. Again, hopefully that project addressed these deficiencies but recommend the District conduct a site visit. This is a lower income, minority neighborhood where use of ped facilities and public transit is clearly high.	Disagree. Recent project completion in the area (FM 430637-1 & -3). All issues described have been corrected. See pictures for Item 28 for reference.	Not needed- issues addressed
31	87015000	1.468	1.689	0.221	L	6	Flush		Y	Y	n/a	n/a	n/a	8/20/2021	Y	N	SR 989/SW 112th Av - sample begins at about SW 230 Terrace. DWS present and correctly installed; PAR is F/S/SR. A fair portion of the facility is new and in good shape but even the older work appears to have little to no slope/cross slope. However, at mp 1.687 (end of the sample) there is a goat trail at the Agape development. Google images from 02/2021 show the same goat trail leading to a bus stop/shelter to the immediate south. Northbound, there is a sidewalk gap of about a block before it resumes on the north side of SW 227 St (DWS at this location appears to be installed partly in the gutter - Google image from 12/2020).	Disagree. Condition corrected and new sidewalk installed. Please see attached field pictures for Item 31.	Not needed- issues addressed
49	87026000	3.72	4.035	0.315	R		6	Raised	Y	N	Y	N	N	8/20/2021	N	N	SR 860 at NW 18th Av - facility is older and some driveway aprons (commercial) are still on a slope. DWS at this location is correctly installed but color on one side is hard to determine due to debris/sand. There are also areas where utility poles narrow the path of travel but nothing narrower than 32" that I can judge. Segment ends at NW 17th ave but VL quality is poor. Checked Google to revalidate the sample: images are from different periods from 2019 to 2021. At least one corner of the intersection has old finger-operated ped buttons and two others appeared to have no ped signals at all, though the crossing was marked/signalized. some of the DWS are either faded beyond color contrast or are covered by debris/sand. Probably best to include this for site visit.	Agree.	To be corrected via FM 447800-1, letting May 2025.
64	87030000	2.071	2.601	0.53	R		5	Raised	Y	N	Y	N	N	9/4/2021	N	N	US 1/SR 5, SW 62 AV, is missing Ped Signal for crossing. Mp 2.132 and 2.407 have older finger-press pedestrian buttons and DWS are stamped grid patterns. DWS at 6nd and midblock are grid patterned though appear to remain tactile. At SW71st and SW72nd there are no paired DWS.	Agree.	To be corrected via ADA Pushbutton Contract FM 429536-5.
167	87061000	0	0.06	0.06	R		15	c	y	n			n/a	7/26/2021	n		MP=0.055 - Drop curb at parking garage entrance, but missing DWS and no marked crossing?	Agree.	To be corrected via ADA Pushbutton Contract FM 429536-5.
171	87062000	1.731	2.094	0.363	L	5	mix		y	y	y	y	n/a	7/26/2021	n	y	MP=2.118 to 2.088 - Steep cross slope at gas station d/w?	Disagree. Previous RRR project did not address steep slopes, per FDM criteria ADA need to be implemented for DWS and curb ramps. Will be addressed through next reconstruction project.	Not needed.
174	87062000	3.176	3.315	0.139	L	5	flush		n/a	y	n	n/a	n/a	7/26/2021	n	y	MP=3.328 - 24th Street Barber Shop parking is in sidewalk adjacent to bike path?	Agree.	To be corrected via ADA Pushbutton Contract FM 429536-5..

#	RDWYID	BMP	EMP	NET	SIDE	SDWLKL	SDWLKR	Curb	DWS	Traffic	Ped	APS	Review Date	Compliant	Verifi	Comments/Notes	D6 Notes	Corrective Action Plan	
175	87062000	3.987	5.468	1.481	R		6	curb	y	n	y	y	n/a	7/26/2021	n	y	MP=4.272, 4.322, 4.337, 5.062, 5.122, 5.187 - Missing or non-compliant DWS at stop-controlled intersection? MP=4.292 - Missing or non-compliant DWS at ped crossing. MP=5.352 - crosswalk missing?	Agree.	To be corrected via FM 447804-1, letting in 2025.
178	87066000	2.025	2.29	0.265	R		5	curb	y	n	y	y	n/a	7/26/2021	y	y	MP=2.025 - Missing or non-compliant DWS at stop-controlled intersection?	Disagree. All corners are in compliance. Please see attached pictures.	Not needed- issues addressed
179	87066000	4.211	4.546	0.335	L	6	curb		y	n	y	y	n/a	7/28/2021	n	y	Specified MP range not in viewer. Reviewed BMP=3.406 to EMP=3.741. MP=3.431, 3.451 - Missing or non-compliant DWS at stop-controlled intersection.	Agree.	To be corrected via FM 443935-1, letting in 2024.
182	87072000	1.159	2.027	0.868	R		6	curb	n	n			n/a	7/29/2021	n	y	MP=1.100, 1.150, 1.175, 1.285, 1.350, 1.505, 1.605, 1.750, 1.910, 1.960, 1.990, 2.015 - Missing or non-compliant DWS at stop-controlled intersection? MP=1.285 - Ramp sloped surface is not wholly contained within the crosswalk markings?	Agree.	To be corrected via FM 449948-1, letting in 2027.
183	87072000	5.129	5.957	0.828	L	7	curb		y	n	y	y	n/a	7/29/2021	n	y	MP=5.159 - Missing or non-compliant DWS at stop-controlled intersection?	Agree.	To be corrected via FM 445745-1, letting in 2027.
184	87072000	6.412	6.823	0.411	R		6	curb	y	n	y	y	n/a	7/29/2021	n	y	MP=6.600, 6.640 - Missing or non-compliant DWS at stop-controlled intersection?	Agree.	To be corrected via ADA Pushbutton Contract FM 429536-5.
185	87072000	7.427	7.54	0.113	R		6	curb	y	n	y	y	n/a	7/29/2021	n	y	MP=7.435 - Missing or non-compliant DWS at stop-controlled intersection?	Agree.	To be corrected via ADA Pushbutton Contract FM 429536-5.
190	87080000	2.67	3.415	0.745	R		5	curb	y	y	y	n	n/a	7/29/2021	n	y	MP=3.400 - Missing ped heads?	Agree.	To be corrected via ADA Pushbutton Contract FM 429536-5.
196	87080900	39.116	39.338	0.222	R		5	curb	y	n	y	y	n/a	7/29/2021	n	y	MP=39.134 - Missing or non-compliant DWS at stop-controlled intersection. Also, joint vertical displacement > 1/4" in s/w?	Agree.	To be corrected via ADA Pushbutton Contract FM 429536-5.
201	87090000	13.672	13.716	0.044	R		6	curb	y	n	y	y	n/a	7/29/2021	n	y	MP=13.697 - Missing or non-compliant DWS at stop-controlled intersection?	Agree.	To be corrected via FM 447828-1, letting in 2027.
206	87091000	4.481	4.99	0.509	R		5	flush	n/a	n	n	n/a	n/a	7/29/2021	n	y	MP=4.490, 4.530 - Concrete slab for drainage? (looks like a walking surface) connects edge of roadway with sidewalk...this could be mistaken as a crosswalk? MP=4.635 - Black Creek Canal bridge has s/w width less than FDOT's 5' standard; also appears to have vertical displacement > 1/4" MP=4.700, 4.830 - Missing or non-compliant DWS at stop-controlled intersection? MP=4.955 - S/w terminates into grass with no logical crossing or connection -- a s/w gap of about 155' +/-?	Agree.	To be corrected via ADA Pushbutton Contract FM 429536-5.
207	87091000	5.007	5.108	0.101	L	6	mix		y	y	y	y	n/a	7/29/2021	y	y	MP=5.013 - S/w terminates into grass with no logical crossing or connection.	Disagree. Recent completion of sidewalk construction along south side. Please see attached pictures for Item 207.	Not needed- issues addressed
208	87120000	3.894	3.919	0.025	R		7	curb	y	n	n	n/a	n/a	8/11/2021	n	y	MP=3.885 - Missing or non-compliant DWS at stop controlled intersection?	Agree.	To be corrected via ADA Pushbutton Contract FM 429536-5.
209	87120000	4.381	4.438	0.057	L	6	curb		n/a	n/a	n	n/a	n/a	8/11/2021	y	y	MP=4.392 - S/w terminates at end of apparent bus bay without logical connection or crossing?	Disagree. Crosswalk available at intersection of SW 132nd Avenue and SW 8th Street.	Not needed.
210	87120000	9.496	9.567	0.071	L	6	curb		y	y	n	n/a	n/a	8/11/2021	y	y	MP=9.567 - Boardwalk across parallel drainage canal does not appear to be 5' minimum width?	Disagree. Boardwalk is outside of FDOT R/W.	Not needed.
212	87120000	10.226	10.283	0.057	L	8	curb		y	n	n	n/a	n/a	8/11/2021	n	y	MP=10.226 - Drop curb (w/ possible non-compliant DWS?) on one side of Tamiami Canal Rd. and a business d/w on the other side; results in a very complex and unclear ped crossing situation. There is no logical or marked ped crossing? MP=10.277 - Missing or non-compliant DWS at stop-controlled intersection?	Agree.	To be corrected via ADA Pushbutton Contract FM 429536-5.
213	87120000	10.45	10.476	0.026	R		7	curb	y	n	n	n/a	n/a	8/11/2021	n	y	MP=10.459 - Missing or non-compliant DWS at stop-controlled intersection?	Agree.	To be corrected via ADA Pushbutton Contract FM 429536-5.
214	87120000	10.574	10.946	0.372	R		7	curb	y	n	y	y	n/a	8/11/2021	n	y	MP=10.624, 10.689 - Missing or non-compliant DWS at stop-controlled intersection? MP=10.739 - Missing DWS at RR crossing?	Agree.	To be corrected via ADA Pushbutton Contract FM 429536-5.
215	87120000	12.337	12.359	0.022	R		8	curb	y	n	n	n/a	n/a	8/11/2021	n	y	MP=12.334 - Missing or non-compliant DWS at stop-controlled intersection? MP=12.374 - Missing or non-compliant DWS at stop-controlled intersection and cracked ramp with vertical discontinuities?	Agree.	To be corrected via FM 443918-3, letting in 2023.
216	87120000	13.341	13.481	0.14	R		7	curb	y	n	n	n/a	n/a	8/11/2021	n	y	MP=13.359, 13.394, 13.479 - Missing or non-compliant DWS at stop-controlled intersection?	Agree.	To be corrected via ADA Pushbutton Contract FM 429536-5.
219	87120000	16.08	16.144	0.064	R		15	curb	y	y	y	n	n/a	8/11/2021	n	y	MP=16.153 - Missing ped signal at signalized intersection?	Agree.	To be corrected via FM 446000-1, letting 2024.
236	87140000	4.416	4.51	0.094	L	11	curb		y	n	y	y	n/a	8/11/2021	y	y	MP=4.427 - Missing or non-compliant DWS at stop-controlled intersection?	Disagree. Driveway has been closed.	Not needed- issues addressed
245	87140000	10.498	10.634	0.136	L	5	curb		y	n	n	n/a	n/a	8/11/2021	n	n/a	MP=10.507 - Missing or non-compliant DWS at stop-controlled intersection?	Agree.	To be corrected via ADA Pushbutton Contract FM 429536-5.
247	87140000	13.07	14.68	1.61	R		6	curb	y	n	y	y	n/a	8/11/2021	n	n/a	MP=13.429, 13.554, 13.749, 13.844, 14.059, 14.149, 14.364, 14.534, 14.589 - Missing or non-compliant DWS at stop-controlled intersection?	Agree.	To be corrected via ADA Pushbutton Contract FM 429536-5.
248	87150000	0.018	0.287	0.269	R		5	flush	n/a	n	n	n/a	n/a	8/11/2021	y	n/a	MP=0.145, 0.275 - Missing or non-compliant DWS at stop-controlled intersection?	Disagree. See attached pictures.	Not needed- issues addressed
252	87170000	1.739	3.579	1.84	R		5	curb	n	n	y	y	n/a	8/11/2021	n	y	MP=2.115 - Missing or non-compliant DWS at stop-controlled intersection? MP=2.185 - Drop curb and ramp are outside the crossing markings?	Agree.	To be corrected via ADA Pushbutton Contract FM 429536-5.
253	87170000	3.997	4.1	0.103	L	8	curb		y	n	n	n/a	n/a	8/12/2021	n	y	MP=4.085 - Missing or non-compliant DWS at stop-controlled intersection?	Agree.	To be corrected via ADA Pushbutton Contract FM 429536-5.
256	87170001	0.69	0.73	0.04	R		8	curb	y	n	n	n/a	n/a	8/12/2021	n	y	MP=0.730 - Missing or non-compliant DWS at roadway crossing?	Agree.	To be corrected via ADA Pushbutton Contract FM 429536-5.
257	87190000	0	0.369	0.369	L	7	curb		y	n	y	y	n/a	8/12/2021	n	y	MP=0.123 - Missing or non-compliant DWS at stop-controlled intersection?	Agree.	To be corrected via ADA Pushbutton Contract FM 429536-5.
259	87220000	0.588	0.737	0.149	L	5	curb		y	n	y	n	n/a	8/12/2021	n	y	MP=0.598, 0.613 - Missing or non-compliant DWS at stop-controlled intersection? MP=0.733 - Missing ped signal at signalized intersection?	Agree for ped signal. DWS are compliant, see attached field pictures.	To be corrected via ADA Pushbutton Contract FM 429536-5.
262	87220000	3.079	3.121	0.042	R		7	curb	y	y	n	n/a	n/a	8/12/2021	n	y	MP=3.095 - S/w alignment is discontinuous - not obvious to one with a sight impairment?	Agree.	To be corrected via ADA Pushbutton Contract FM 429536-5.

#	RDWYID	BMP	EMP	NET	SIDE	SDWLK	SDWLKR	Curb	DWS	Traffic	Ped	APS	Review Date	Compliant	Verifi	Comments/Notes	D6 Notes	Corrective Action Plan
263	87240000	7.184	7.41	0.226	R		5	curb	y	n	y	n/a	8/12/2021	n	y	MP=7.230, 7.370 - Missing or non-compliant DWS at stop-controlled intersection? MP=7.360 - DWS improperly placed within splitter island < 6'-wide?	Agree.	To be corrected via ADA Pushbutton Contract FM 429536-5.
264	87240000	7.221	7.638	0.417	L	6	curb		y	n	y	n/a	8/12/2021	n	y	MP=7.188, 7.303, 7.383, 7.418, 7.453, 7.548, 7.623 - Missing or non-compliant DWS at stop-controlled intersection?	Agree.	To be corrected via ADA Pushbutton Contract FM 429536-5.
267	87250000	1.074	1.519	0.445	L	6	curb		y	n	y	n/a	8/13/2021	n	y	MP=1.072, 1.122, 1.182, 1.247, 1.447 - Missing or non-compliant DWS at stop-controlled intersection? MP=1.332 - Missing DWS at RR crossing?	Agree.	To be corrected via ADA Pushbutton Contract FM 429536-5.
268	87250000	1.519	1.705	0.186	L	6	curb		y	n	n/a	n/a	8/13/2021	n	y	MP=1.702 - Missing or non-compliant DWS at stop-controlled intersection?	Agree.	To be corrected via ADA Pushbutton Contract FM 429536-5.
269	87250000	1.705	2.585	0.88	L	6	curb		y	n	y	n/a	8/13/2021	n	y	MP=1.867, 2.472, 2.542 - Missing or non-compliant DWS at stop-controlled intersection?	Agree.	To be corrected via ADA Pushbutton Contract FM 429536-5.
273	87250000	5.754	5.822	0.068	R		6	curb	y	n	y	n/a	8/13/2021	n	y	MP=5.780 - Missing or non-compliant DWS at stop-controlled intersection?	Agree.	To be corrected via ADA Pushbutton Contract FM 429536-5.
275	87281000	3.403	3.599	0.196	R		8	curb	y	n	y	n/a	8/13/2021	n	y	MP=3.400, 3.445, 3.495, 3.540, 3.600 - Missing or non-compliant DWS at stop-controlled intersection?	Agree.	To be corrected via 447809-1, letting in 2025.
276	87281000	3.608	3.736	0.128	L	6	curb		y	n	y	n/a	8/13/2021	n	y	MP=3.675, 3.745 - Missing or non-compliant DWS at stop-controlled intersection?	Agree.	To be corrected via 447809-1, letting in 2025.
277	87281000	5.229	5.318	0.089	R		5	curb	y	n	y	n/a	8/13/2021	n	y	MP=5.210 - Sidewalk gap at RR crossing? MP=5.290 - Missing or non-compliant DWS at stop-controlled intersection and missing ped signal at crossing?	Agree.	To be corrected via ADA Pushbutton Contract FM 429536-5.
278	87281000	5.721	5.741	0.02	L	17	curb		y	n	n/a	n/a	8/13/2021	n	y	MP=5.735 - Missing or non-compliant DWS at stop-controlled intersection?	Agree.	To be corrected via ADA Pushbutton Contract FM 429536-5.
279	87281000	8.253	8.636	0.383	L	6	curb		y	n	n/a	n/a	8/13/2021	n	y	MP=8.230, 8.270, 8.335, 8.400 - Missing or non-compliant DWS at stop-controlled intersection?	Agree.	To be corrected via 443927-1, letting in 2023.
280	87281000	8.505	9.114	0.609	R		6	curb	y	n	y	n/a	8/13/2021	n	y	MP=8.505, 8.570, 8.630, 8.695, 8.815, 8.945, 9.110 - Missing or non-compliant DWS at stop-controlled intersection? MP=8.760 - Missing or non-compliant DWS at midblock crossing?	Agree.	To be corrected via 443927-1, letting in 2023.
281	87281000	9.114	9.334	0.22	R		6	curb	y	n	y	n/a	8/13/2021	n	y	MP=9.200, 9.330 - Missing or non-compliant DWS at stop-controlled intersection? Also, drainage inlet within sloped surface in front of used car lot (MP=9.200)?	Agree.	To be corrected via 443927-1, letting in 2023.
282	87281000	9.582	10.456	0.874	R		5	curb	y	n	y	n/a	8/13/2021	n	y	MP=9.580, 9.705, 9.885, 10.080, 10.145 - Missing or non-compliant DWS at stop-controlled intersection?	Agree.	To be corrected via 443927-1, letting in 2023.
284	87281000	10.532	11.735	1.203	R		5	curb	n	n	y	n/a	8/13/2021	n	y	MP=10.570, 10.705, 10.965, 11.485 - Missing or non-compliant DWS at stop-controlled intersection? MP=11.305 - missing curb ramps at large commercial d/w?	Agree.	To be corrected via 447803-1, letting in 2025.
285	87300000	4.653	5.378	0.725	R		6	curb	y	n	y	n/a	8/16/2021	n	y	MP=4.845 - Missing or non-compliant DWS at stop-controlled intersection?	Agree.	To be corrected via ADA Pushbutton Contract FM 429536-5.
286	90003000	0.825	0.94	0.115	R		16	curb	y	n	n/a	n/a	8/16/2021	n	y	MP=0.830 - Missing or non-compliant DWS at accessible parking ramps?	Agree.	To be corrected via ADA Pushbutton Contract FM 429536-5.
293	90010000	3.797	3.926	0.129	L	10			y	n	n/a	n/a	8/16/2021	n	y	MP=3.841 - Missing or non-compliant DWS at stop-controlled intersection?	Agree.	To be corrected via 446011-1, letting in 2026.
306	90060000	0.539	0.627	0.088	L	6	flush		n/a	n	n/a	n/a	8/16/2021	n	n/a	MP=0.612 - Missing or non-compliant DWS at stop-controlled intersection?	Agree.	To be corrected via ADA Pushbutton Contract FM 429536-5.
314	90060000	7.115	7.327	0.212	R		6	flush	n/a	n	n/a	n/a	8/16/2021	n	n/a	MP=7.260 - Missing or non-compliant DWS at stop-controlled intersection?	Agree.	To be corrected via ADA Pushbutton Contract FM 429536-5.
316	90060000	8.815	9.03	0.215	R		6	flush	n/a	n/a	n/a	n/a	8/16/2021	n	y	MP=8.815 S/w separated from roadway by grass strip terminates. MP=9.030 - S/w begins again. Distance between these MPs - rumble strip sets provide only separation between the improved walking surface and the roadway?	Agree.	To be corrected via ADA Pushbutton Contract FM 429536-5.
317	90060000	9.016	9.042	0.026	L	6	flush		n/a	n	n/a	n/a	8/16/2021	n	y	MP=9.067 - Missing or non-compliant DWS at stop-controlled intersection? Also, Dollar Tree parking lot appears to have significant water ponding that encroaches into sidewalk.	Agree.	To be corrected via ADA Pushbutton Contract FM 429536-5.
318	90060000	9.03	9.098	0.068	R		6	flush	n/a	n	n/a	n/a	8/16/2021	n	n/a	MP=9.060 - Missing or non-compliant DWS at stop-controlled intersection? MP=9.100 S/w separated from roadway by grass strip terminates. MP=9.170 - S/w begins again. Distance between these MPs - rumble strip sets provide only separation between the improved walking surface and the roadway?	Agree.	To be corrected via ADA Pushbutton Contract FM 429536-5.
319	90060000	9.375	9.501	0.126	L	6	flush		n/a	n	n/a	n/a	8/16/2021	n	n/a	MP=9.472, 9.497 - Missing or non-compliant DWS at stop-controlled intersection?	Agree.	To be corrected via ADA Pushbutton Contract FM 429536-5.
325	90060000	15.027	15.215	0.188	L	8	flush		n/a	n	n/a	n/a	8/16/2021	n	y	MP=15.032, 15.072, 15.097, 15.172, 15.222 - Missing or non-compliant DWS at stop-controlled intersection?	Agree.	To be corrected via FM 447810-1, letting in 2025.
326	90060000	16.218	16.348	0.13	L	6	flush		n/a	n	n/a	n/a	8/16/2021	n	y	MP=16.352 - Missing or non-compliant DWS at stop-controlled intersection?	Agree.	To be corrected via FM 447810-1, letting in 2025.
330	90060000	25.415	25.444	0.029	R		4	flush	n/a	n	n/a	n/a	8/16/2021	n	n/a	Segment flagged for width < 5'. MP=25.410, 25.425 - Missing or non-compliant DWS at stop-controlled intersection? MP=25.410 S/w separated from roadway by grass strip terminates. MP=25.425 - S/w begins again. Distance between these MPs - no discernable separation between the improved walking surface and the roadway?	Agree. Sidewalk was installed by property owner and after coordination with owners the sidewalk is no longer needed as connection is provided within their property. Sidewalk will be removed.	To be corrected via FM 443921-1, letting May 2023.

S/W Miles	Percent Compliant				
	SDWLK	Curb Ramp	DWS	Ped Signal	Compliant ?
108.3	98.5%	98.8%	83.3%	97.0%	82.7%
Percent Compliant	325	326	275	320	273
# compliant rows	330	330	330	330	330