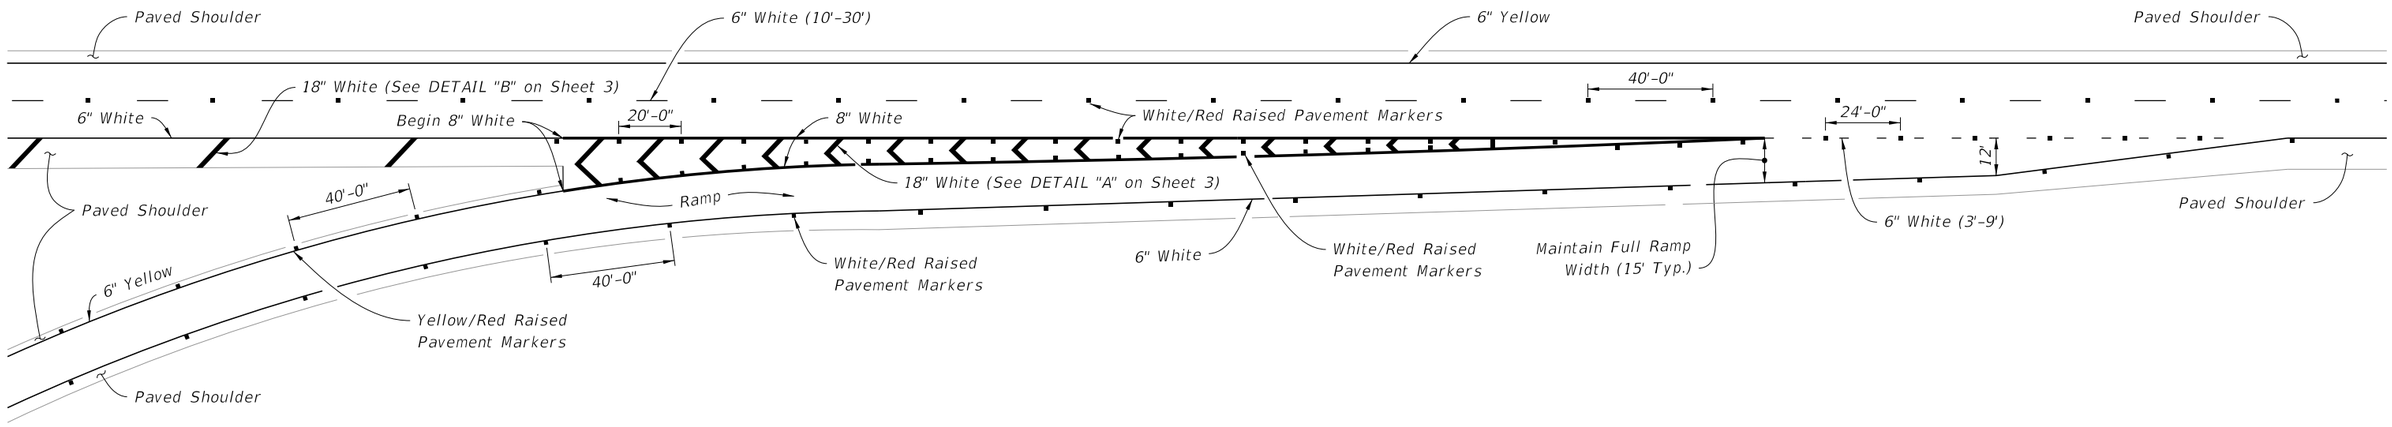

TAPER - TYPE ENTRANCE

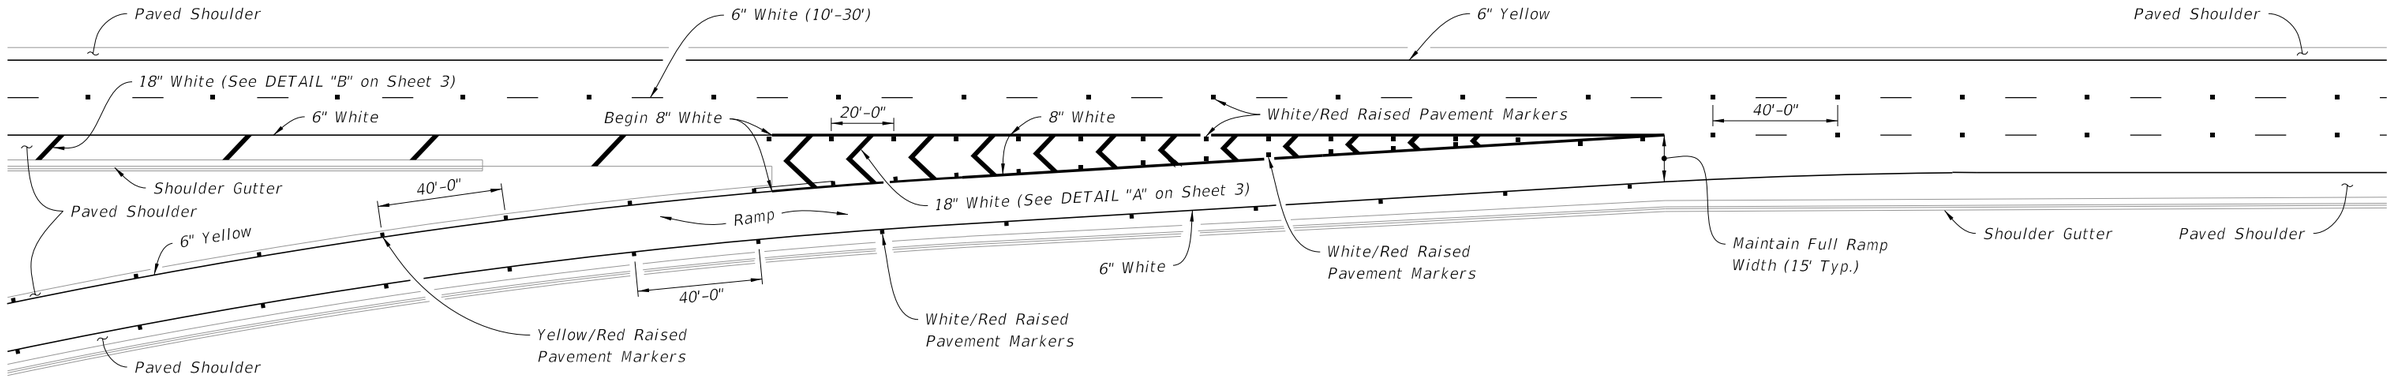

PARALLEL - TYPE ENTRANCE

SINGLE LANE RAMPS - ENTRANCE TERMINALS

10/6/2022 2:41:44 PM

LAST REVISION	REVISION	DESCRIPTION:	FDOT FY 2023-24 STANDARD PLANS	INTERCHANGE MARKINGS	INDEX	SHEET
11/01/21					711-003	1 of 8

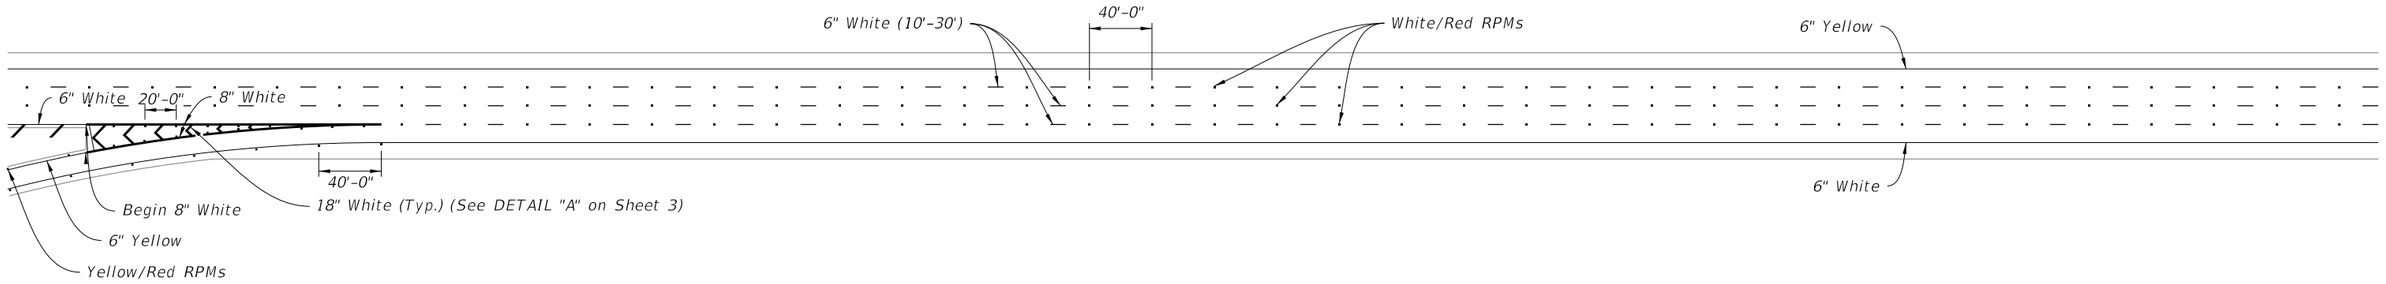

PARALLEL-TYPE ENTRANCE WITH ADDED LANE

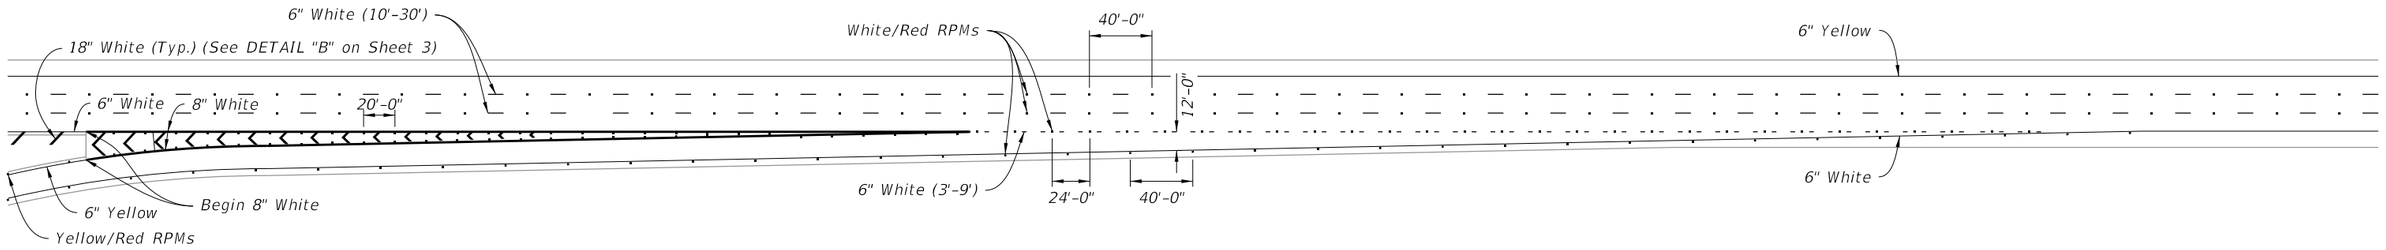

TAPER-TYPE ENTRANCE

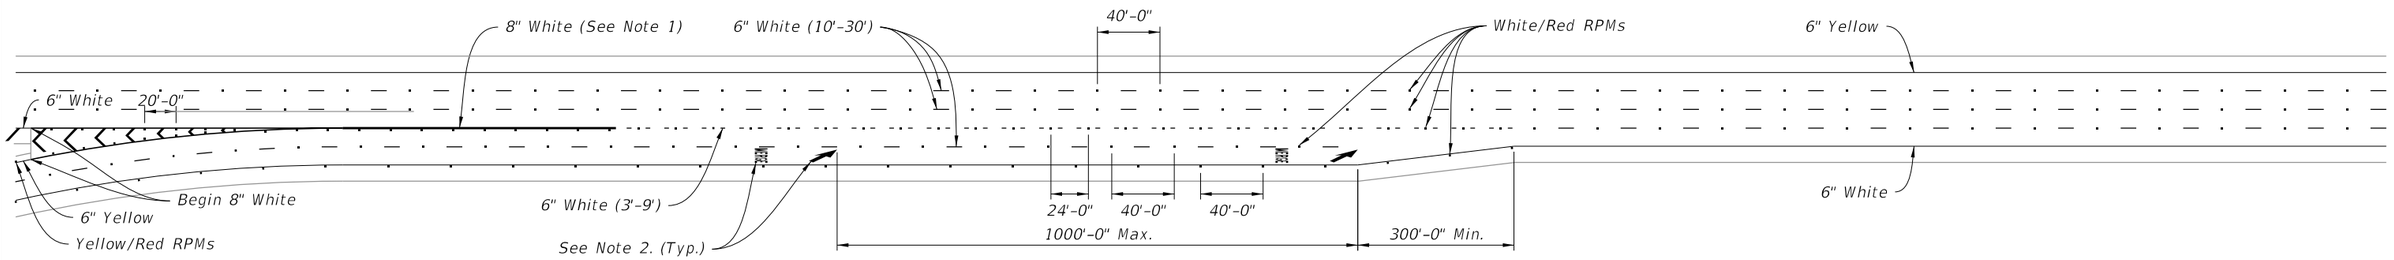

TWO-LANE PARALLEL-TYPE ENTRANCE WITH ADDED LANE
(Single-Lane Parallel-Type Entrance Without Added Lane Similar, See Note 3)

NOTES:

1. Extend this 8" white Pavement Marker one-fourth the length of the acceleration lane from the gore markings.

2. See Index 711-001 for pavement message dimensions and details.

3. Merge Pavement Message and Arrow only used for Two-Lane Entrances.

TYPICAL PAVEMENT MARKINGS AT ENTRANCE RAMPS

LAST REVISION	REVISION	DESCRIPTION:			INDEX	SHEET
11/01/21			FY 2023-24 STANDARD PLANS	INTERCHANGE MARKINGS	711-003	2 of 8

12/20/2024 3:08:19 PM

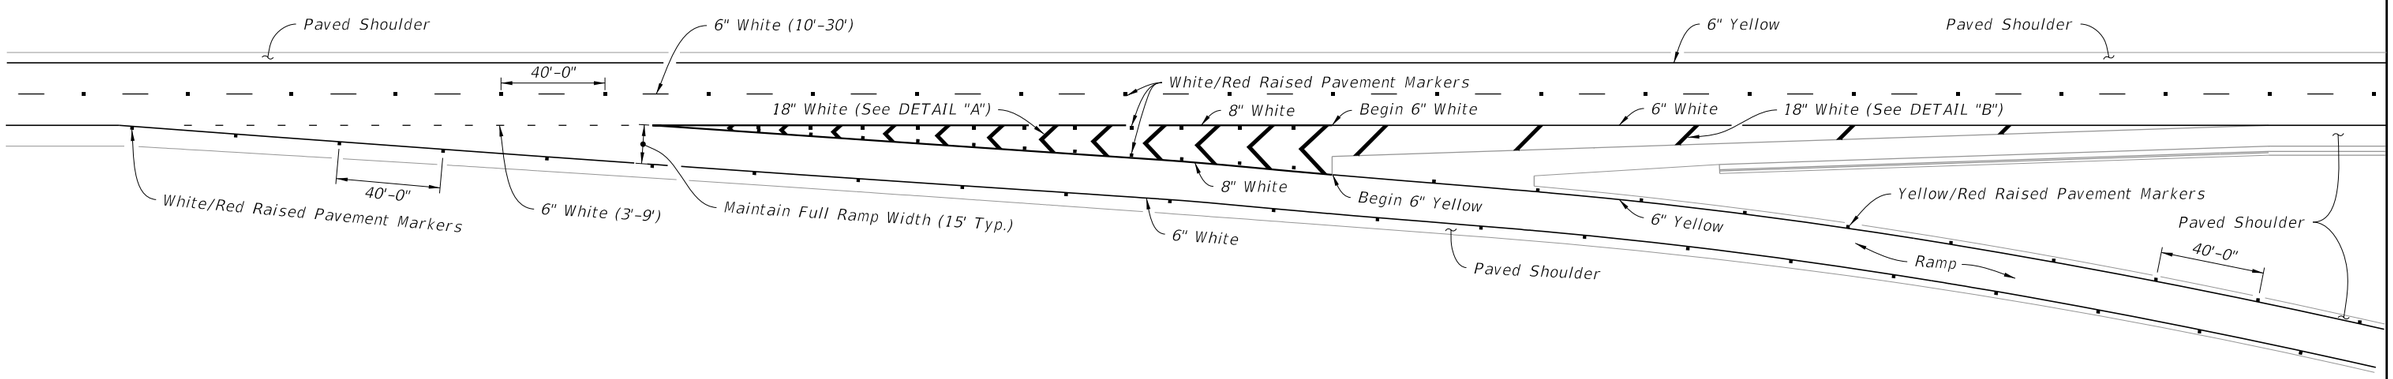

TWO THRU LANES

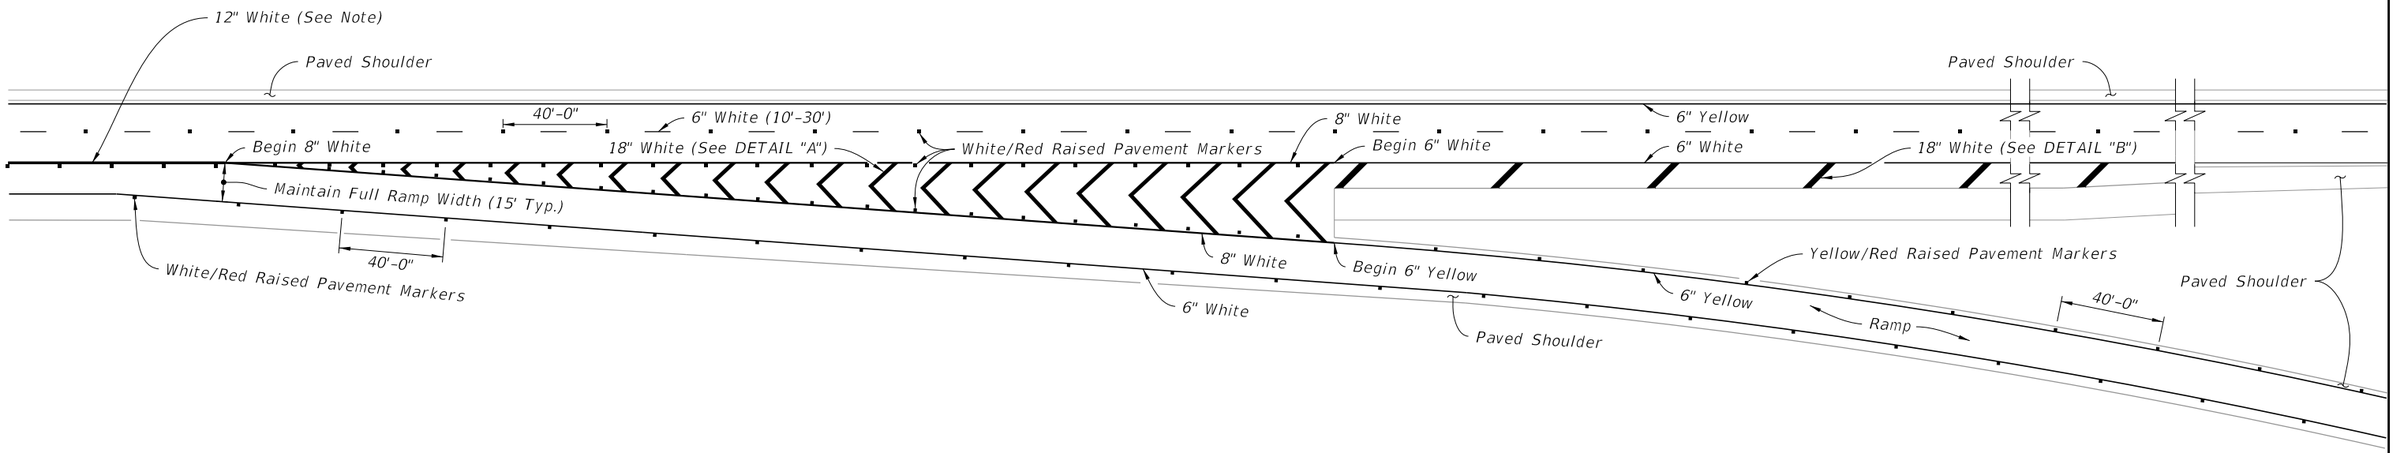

THREE APPROACH LANES - TWO THRU LANES

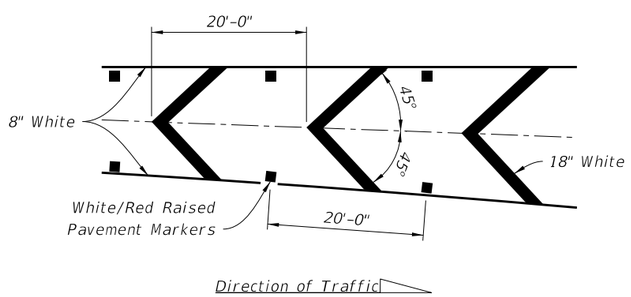

DETAIL "A"

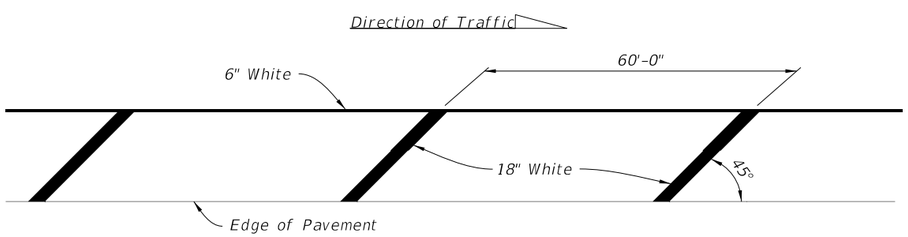

DETAIL "B"

NOTE:
Extend 12" White 300' from the gore markings.

SINGLE LANE RAMPS - EXIT TERMINALS

LAST REVISION	REVISION	DESCRIPTION:			INDEX	SHEET
11/01/21			FY 2023-24 STANDARD PLANS	INTERCHANGE MARKINGS	711-003	3 of 8

10/6/2022 2:41:45 PM

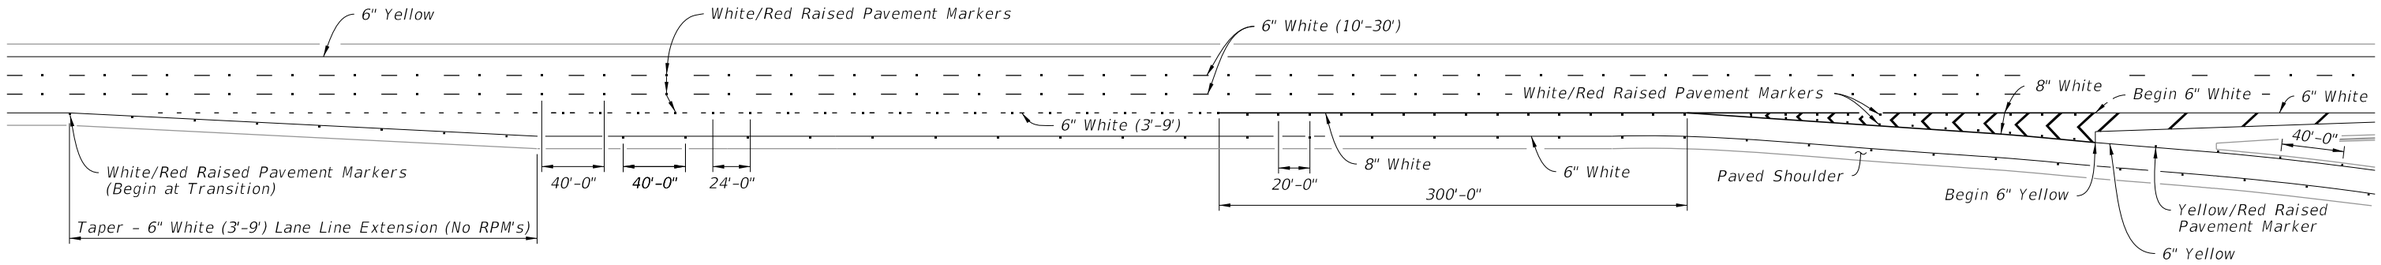

PARALLEL DECELERATION LANE

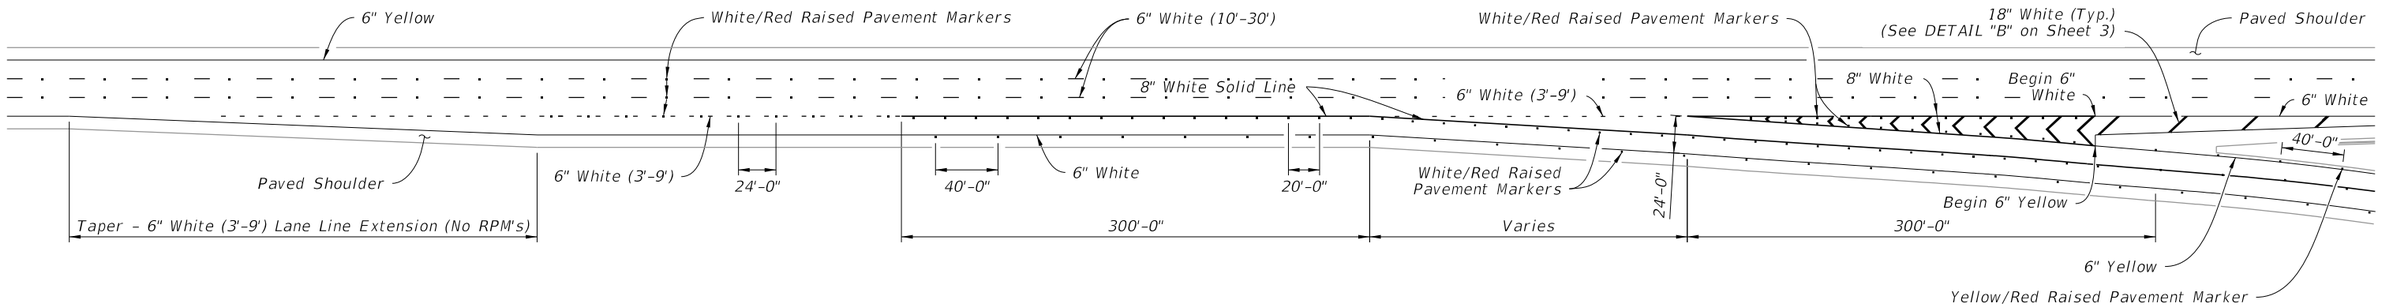

MARKINGS AT DUAL LANE EXITS

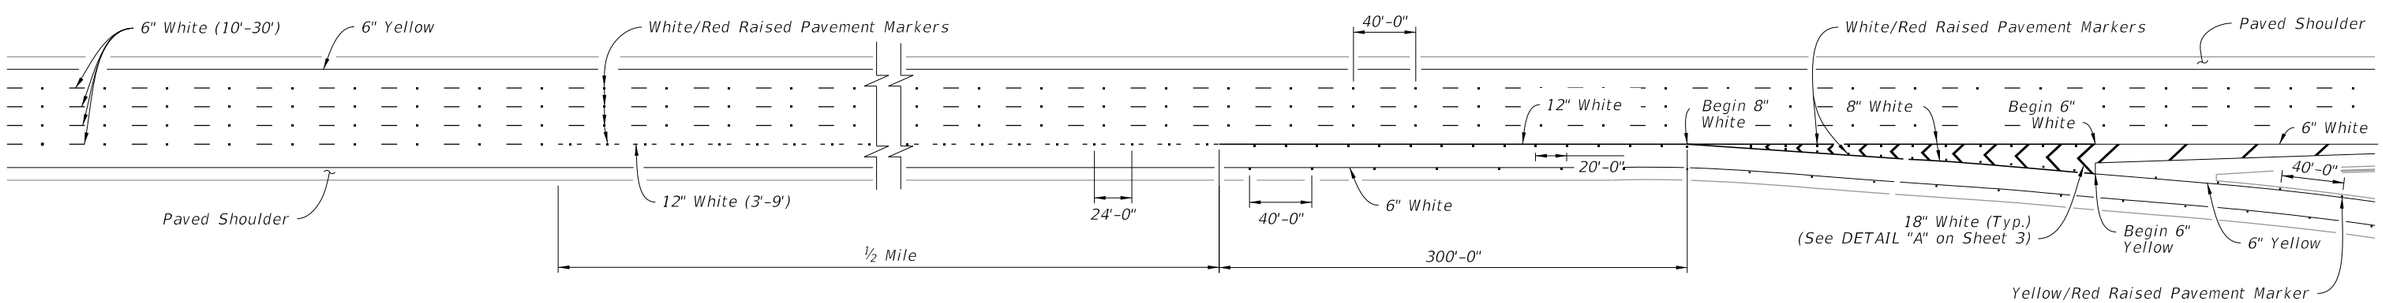

LANE DROP MARKINGS AT EXIT RAMPS

10/6/2022 2:41:45 PM

TYPICAL PAVEMENT MARKINGS AT EXIT RAMPS

LAST REVISION	REVISION	DESCRIPTION:	FY 2023-24 STANDARD PLANS	INTERCHANGE MARKINGS	INDEX	SHEET
11/01/21					711-003	4 of 8

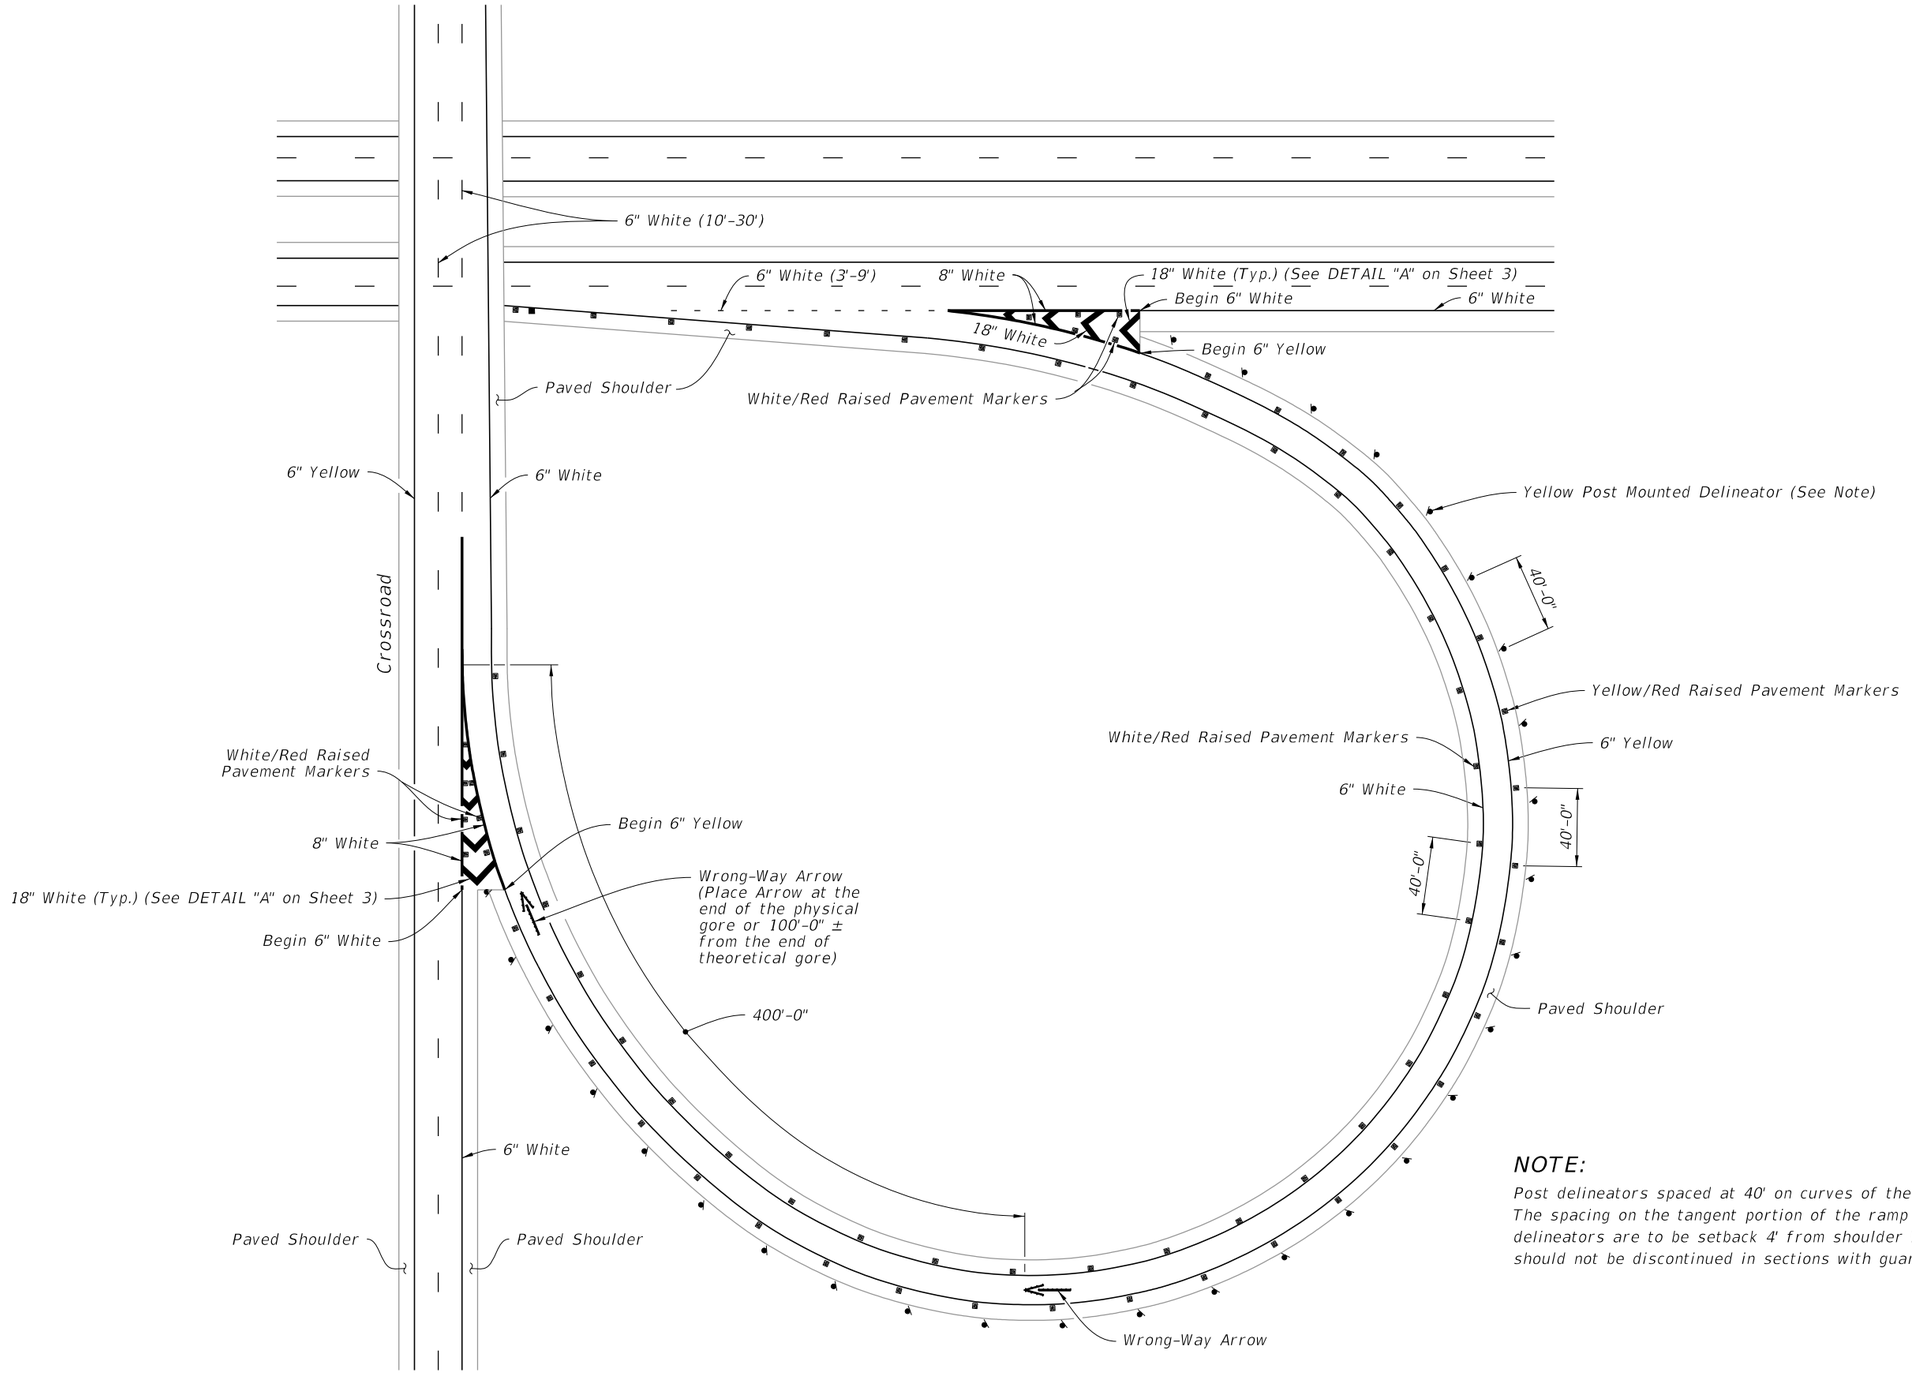

NOTE:

Post delineators spaced at 40' on curves of the entrance and exit of ramps. The spacing on the tangent portion of the ramp section is 300'-0". All delineators are to be setback 4' from shoulder break. Post delineators should not be discontinued in sections with guardrail.

TYPICAL CURVED EXIT RAMP

10/6/2022 2:41:46 PM

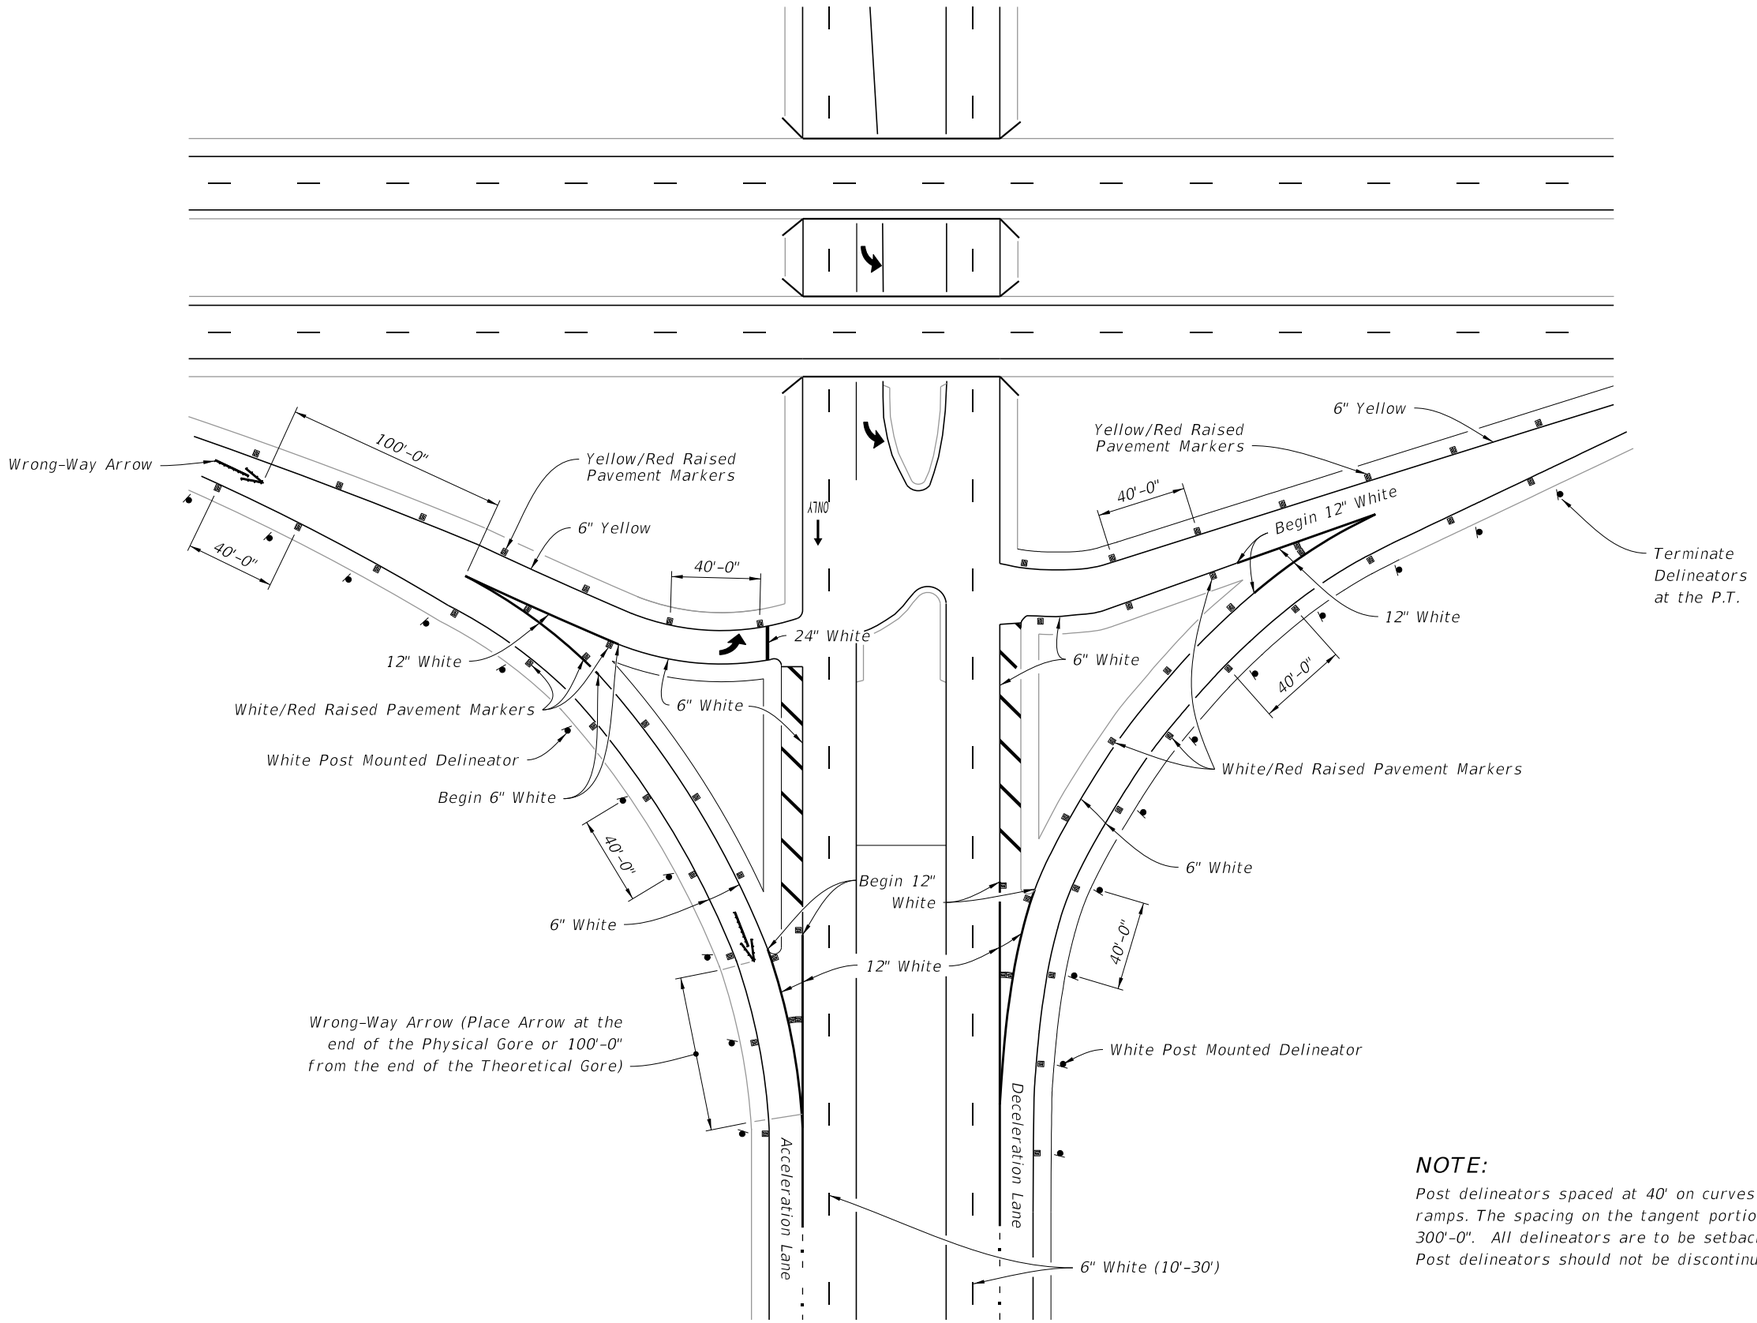

NOTE:

Post delineators spaced at 40' on curves of the entrance and exit of ramps. The spacing on the tangent portion of the ramp section is 300'-0". All delineators are to be setback 4' from shoulder break. Post delineators should not be discontinued in sections with guardrail.

TYPICAL INTERSECTION

10/6/2022 2:42:13 PM

LAST REVISION	REVISION	DESCRIPTION:	FY 2023-24 STANDARD PLANS	INTERCHANGE MARKINGS	INDEX	SHEET
11/01/21					711-003	6 of 8

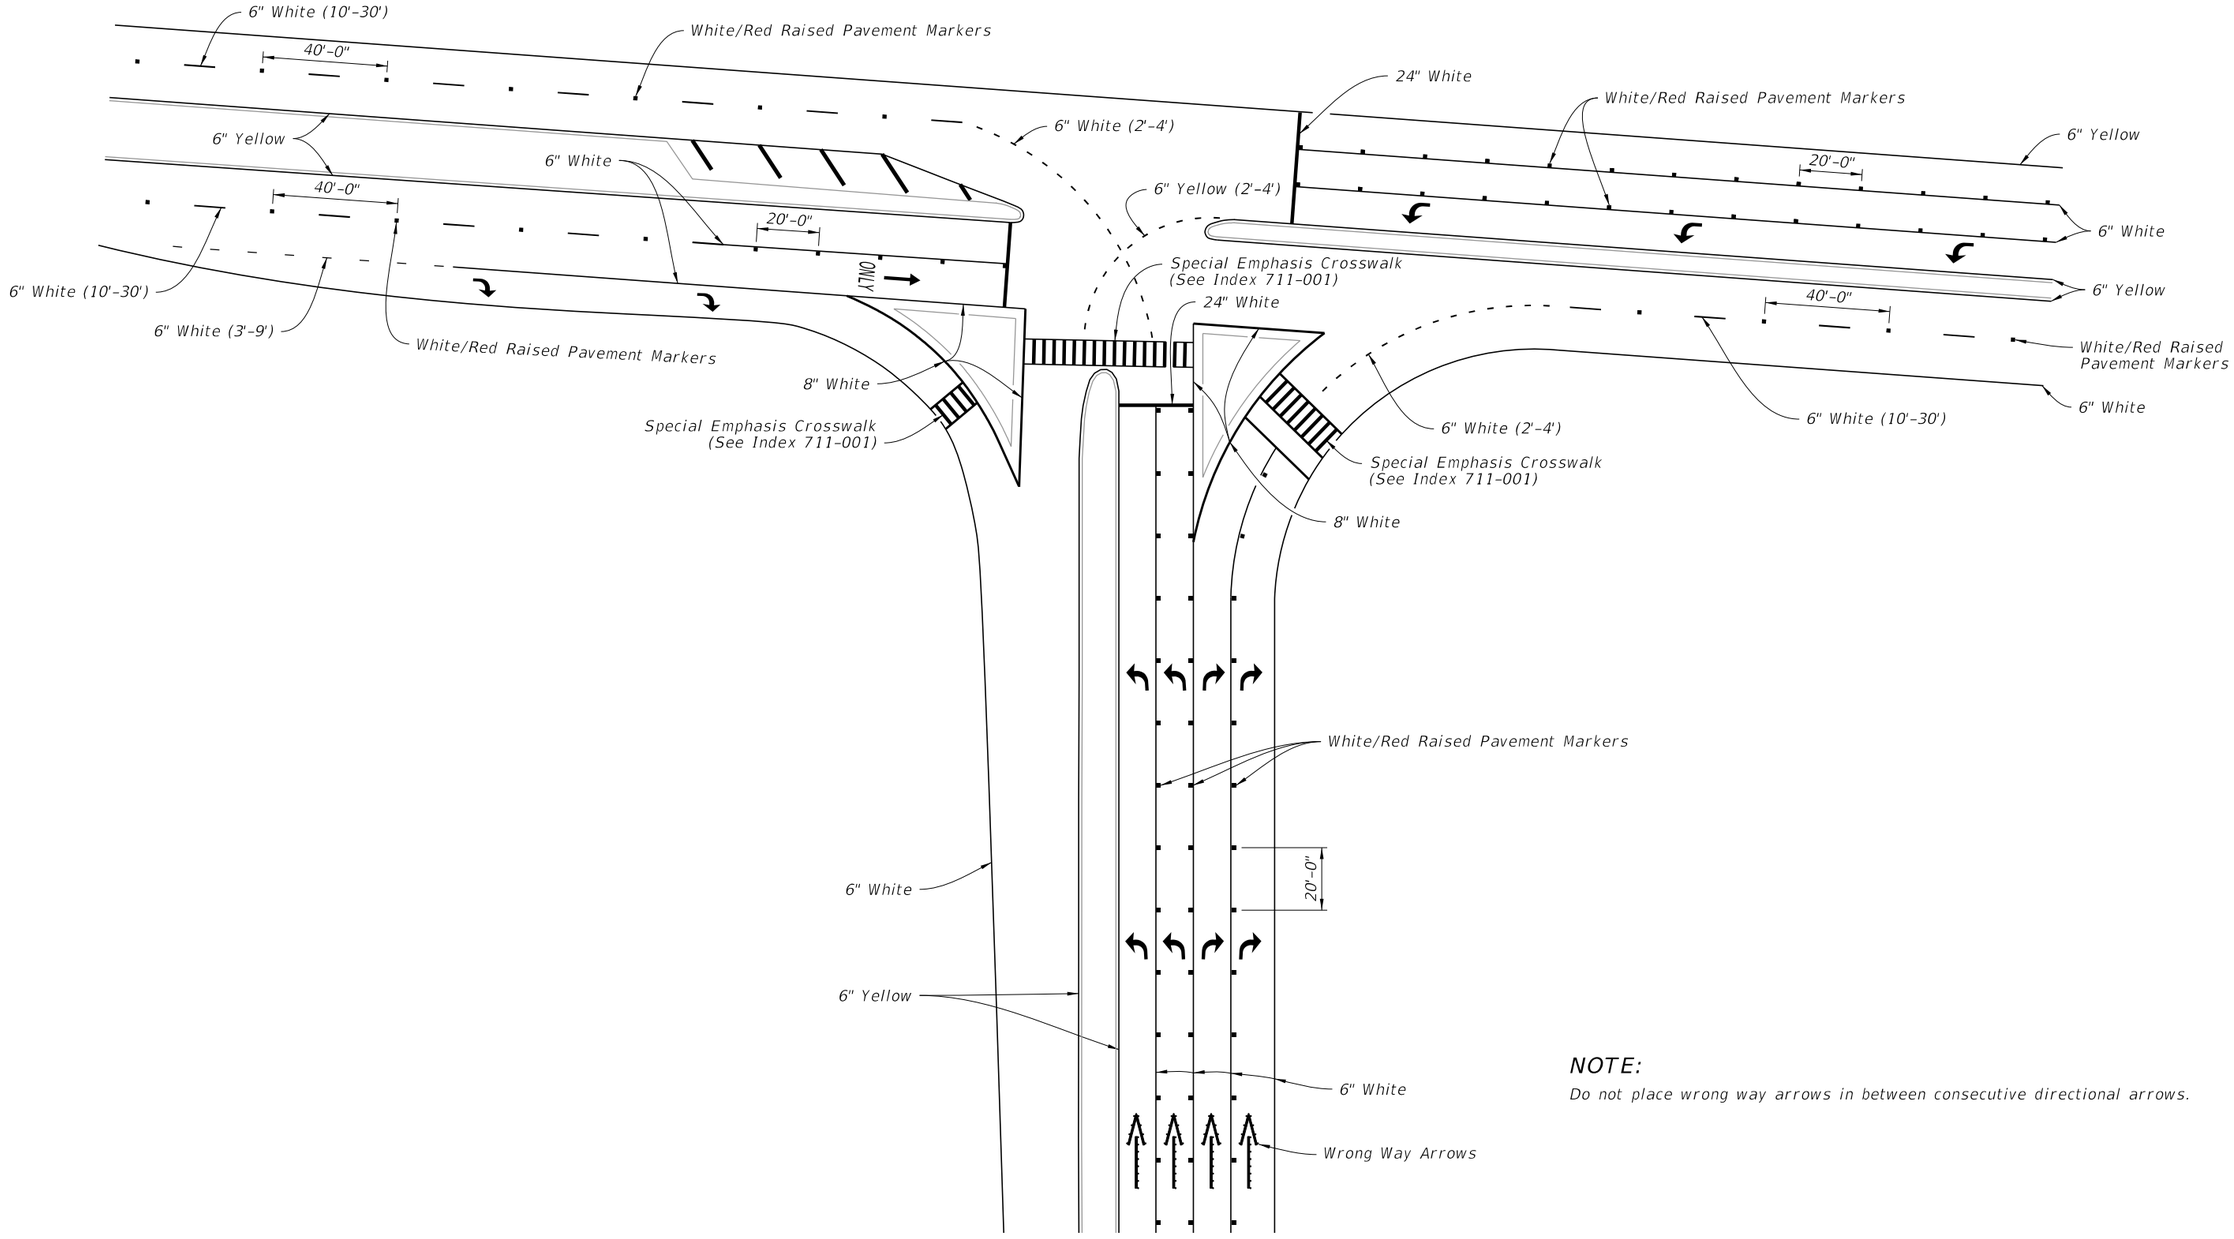

NOTE:

Do not place wrong way arrows in between consecutive directional arrows.

TYPICAL PARTIAL CLOVERLEAF/TRUMPET EXIT RAMP

LAST REVISION	REVISION	DESCRIPTION:	FDOT FY 2023-24 STANDARD PLANS	INTERCHANGE MARKINGS	INDEX	SHEET
11/01/21					711-003	7 of 8

10/6/2022 2:42:14 PM

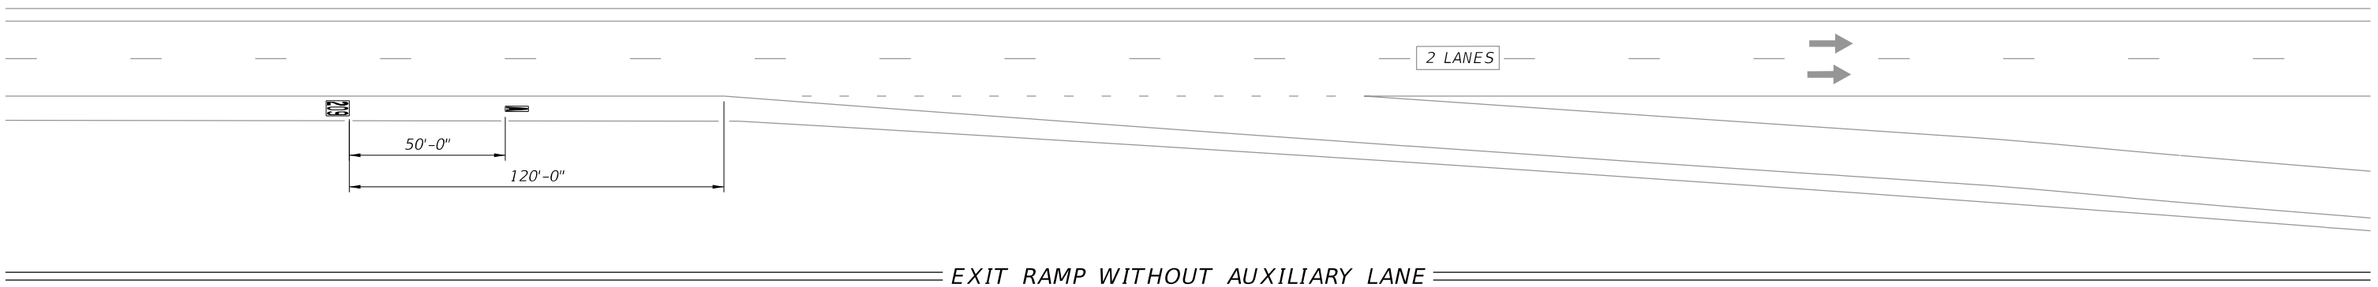

EXIT RAMP WITHOUT AUXILIARY LANE

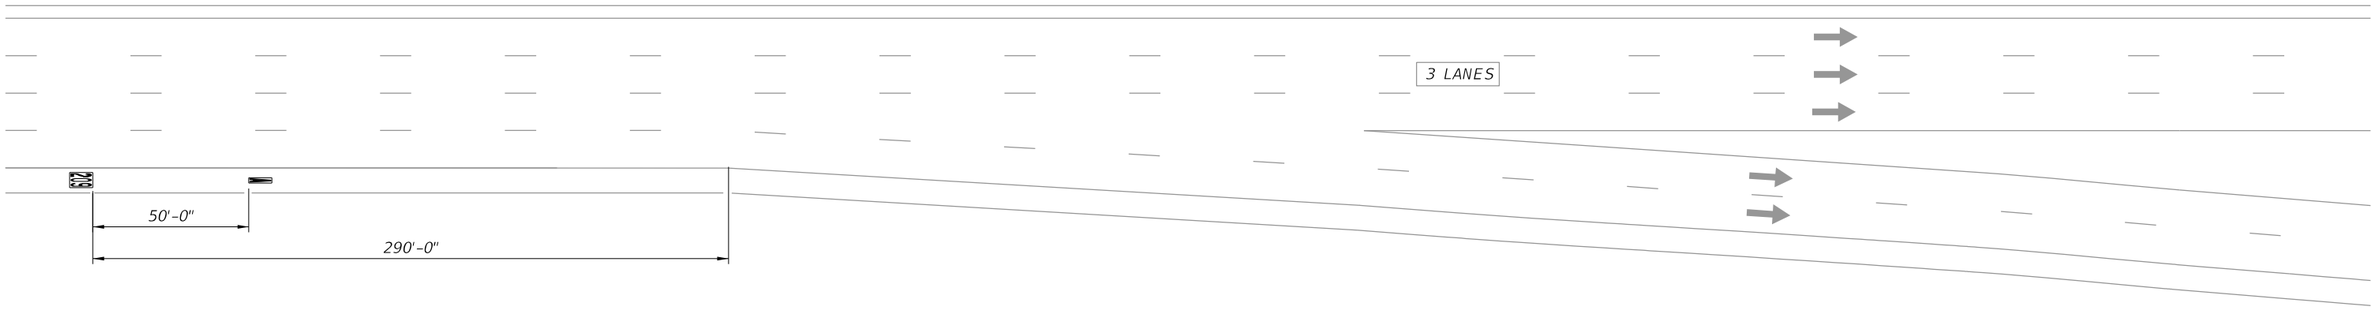

EXIT RAMP WITH AUXILIARY LANE

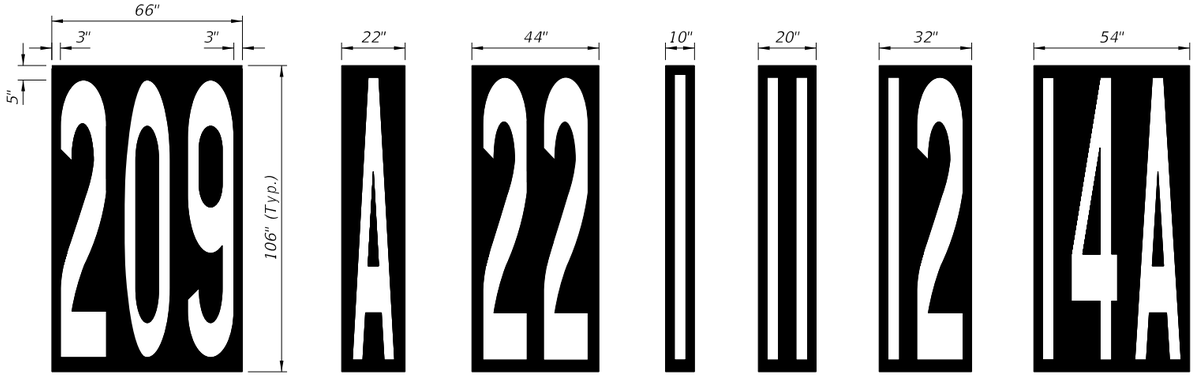

MAT DIMENSIONS

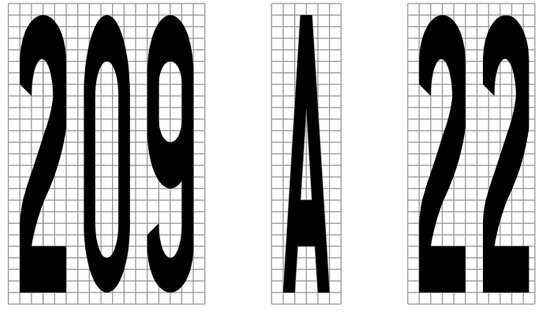

MESSAGE SIZE AND SPACING

NOTES:

1. This Index shows layouts for 1, 2, and 3 digit numbers and letters.
2. The message consist of white letters and numbers with black contrasting material.
3. The "EXIT NUMBER" position remains the same distance from the beginning of taper regardless of the number of lines of information.
4. All Grids are 4" x4".

EXIT RAMP MESSAGING

10/6/2022 2:42:14 PM

LAST REVISION	REVISION	DESCRIPTION:			INDEX	SHEET
11/01/21			FY 2023-24 STANDARD PLANS	INTERCHANGE MARKINGS	711-003	8 of 8