



C:\projects\standards\roadway\17300-s\17345-01.dgn
 r0960/h
 11:48:32 AM
 12/30/2011

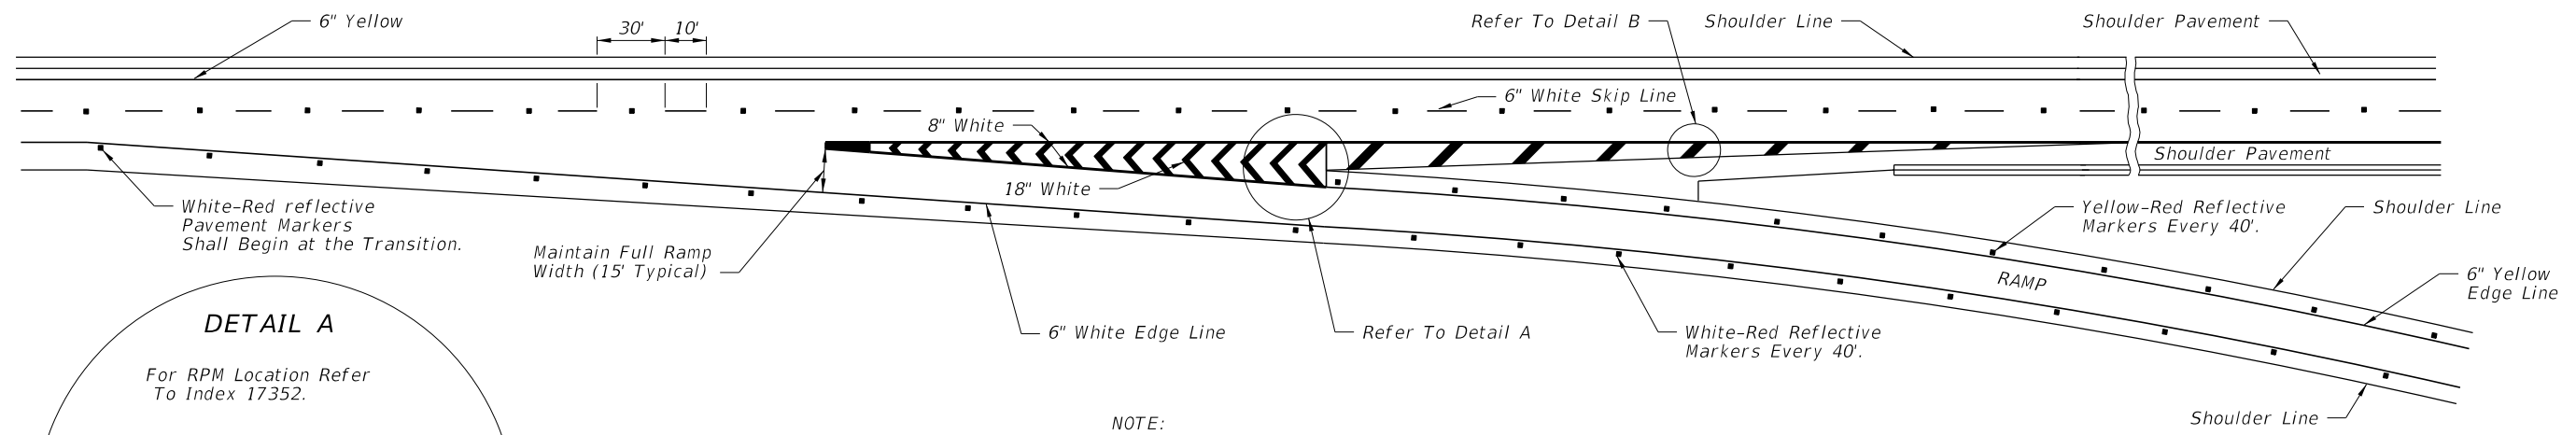


DETAIL A

For RPM Location Refer To Index 17352.

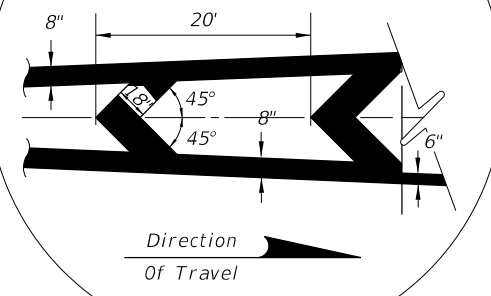

NOTE:
 Reflective pavement markers are installed adjacent to the edge line.


NORMAL TAPERED EXIT
 (TWO THRU LANES)

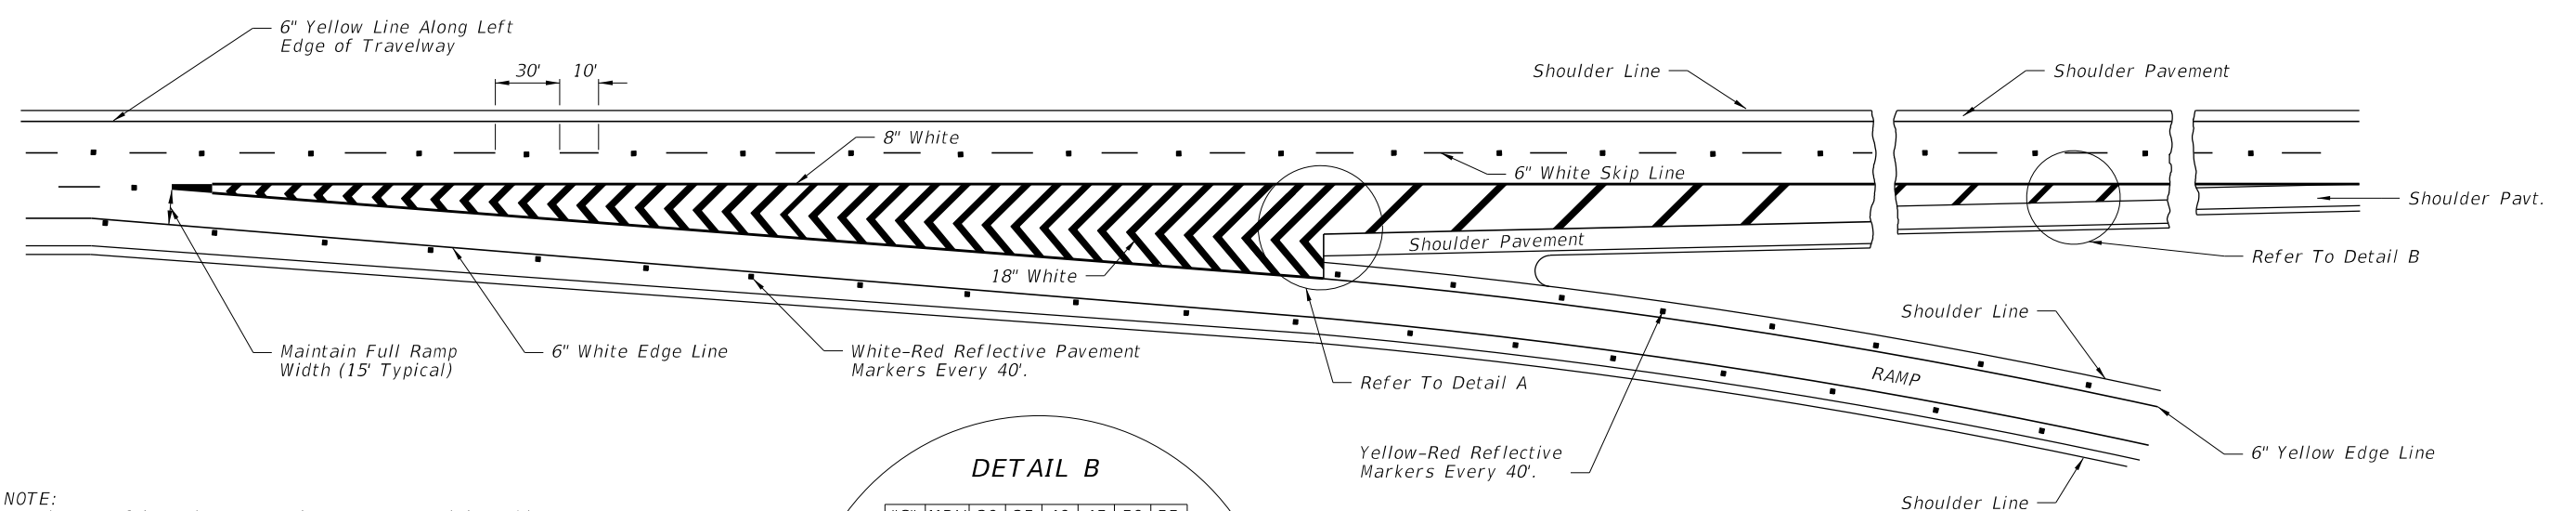

DETAIL B

"S" MPH	30	35	40	45	50	55
"X" Ft.	20	20	40	40	60	60


Passenger Car, Daytime, Posted Speeds Or 85th Percentile (Use Higher Value)

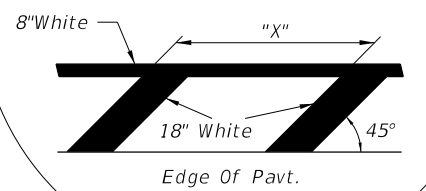


NOTE:
 In advance of lane drops at exit ramps a special marking pattern may be used to distinguish the lane drop situation from a normal exiting ramp or auxiliary lane. A typical special marking for lane drops consist of 8" wide by 3' long white stripes separated by 9' gaps. If used, this special marking should begin 1/2 mile in advance of the theoretical gore point. Where lane changes may cause conflicts, an 8" wide solid white channelizing line may be extended 300' upstream from the theoretical gore. (MUTCD Section 3B.05).

NORMAL TAPERED EXIT ONLY
 (TWO THRU LANES - THREE APPROACH LANES)


C:\projects\standards\roadway\17300-s\17345-02.dgn
 r1960/h
 11:48:33 AM
 12/30/2011

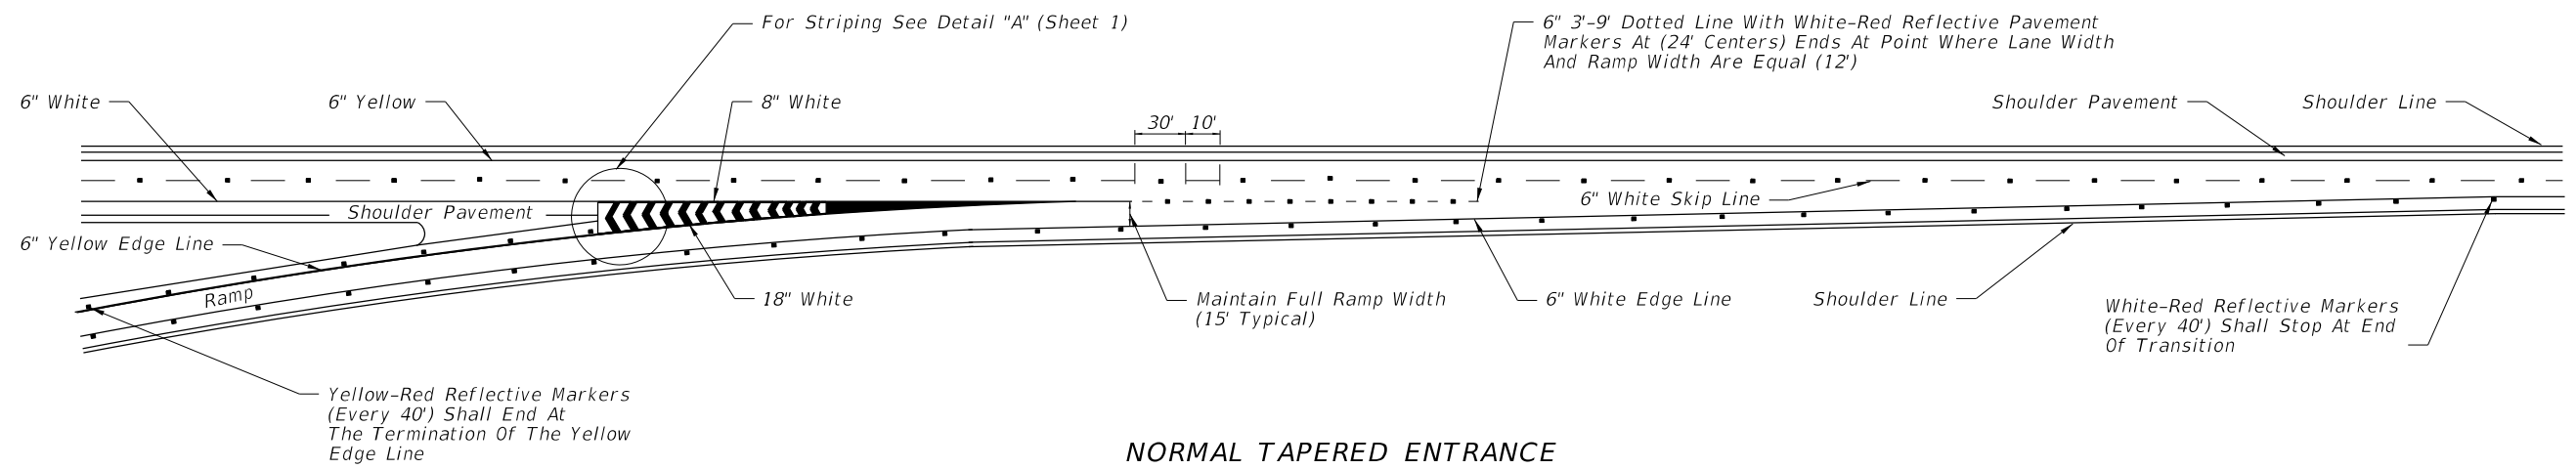




NORMAL TAPERED ENTRANCE

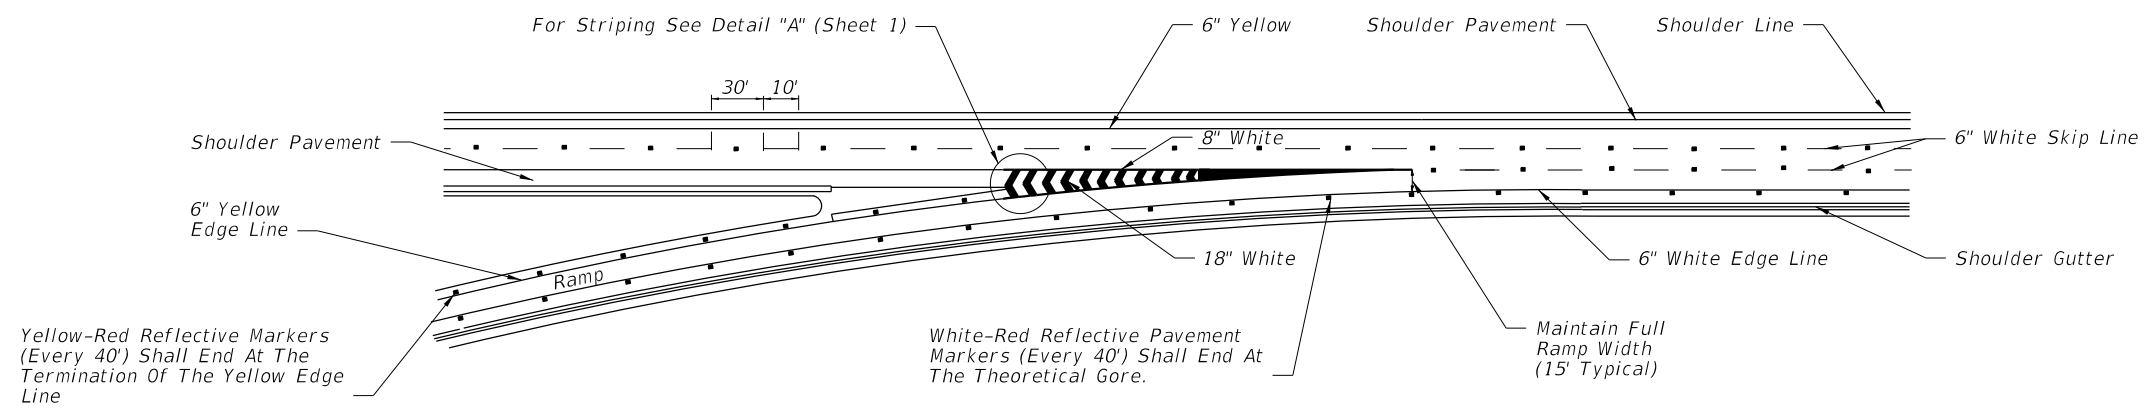

NORMAL TAPERED ENTRANCE WITH ADDED LANE

LAST REVISION	DESCRIPTION:	 FDOT DESIGN STANDARDS FY 2012/2013	INTERCHANGE MARKINGS	INDEX NO.	SHEET NO.
07/01/10				17345	2

C:\projects\standards\roadway\17300-s\17345-03.dgn
 r10960/h
 11:48:33 AM
 12/30/2011

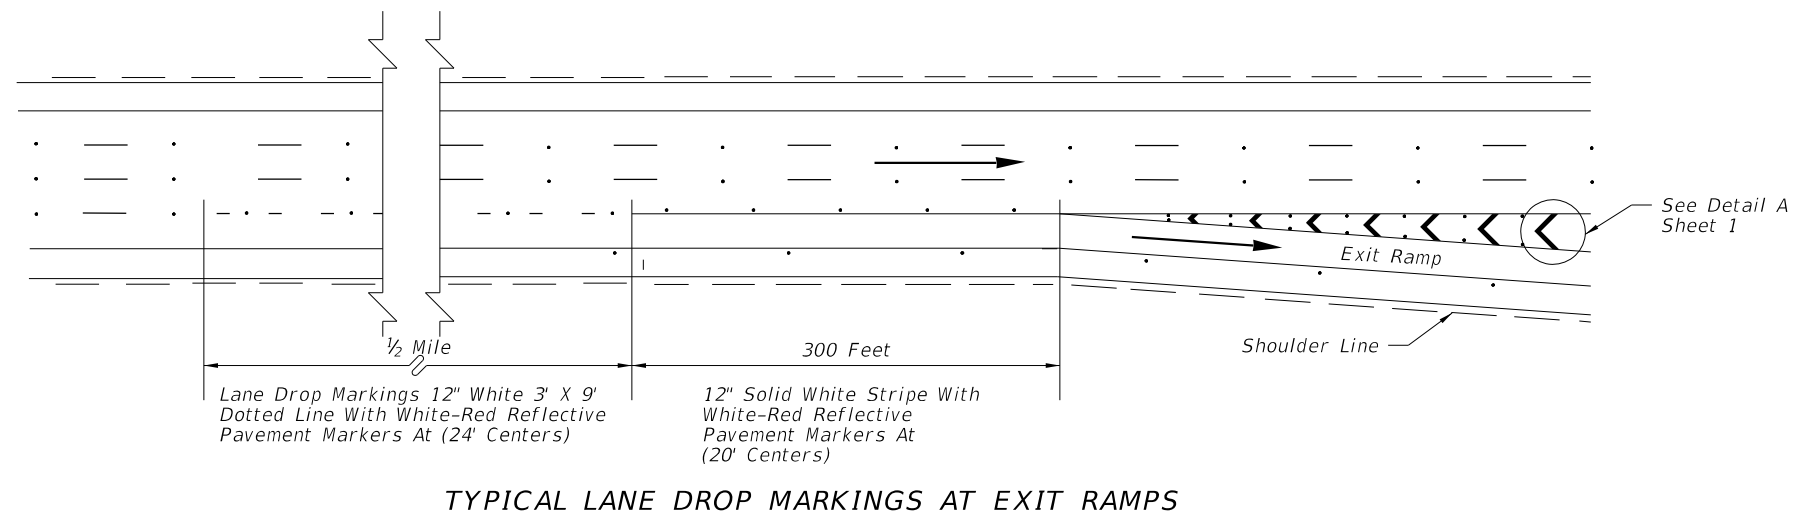
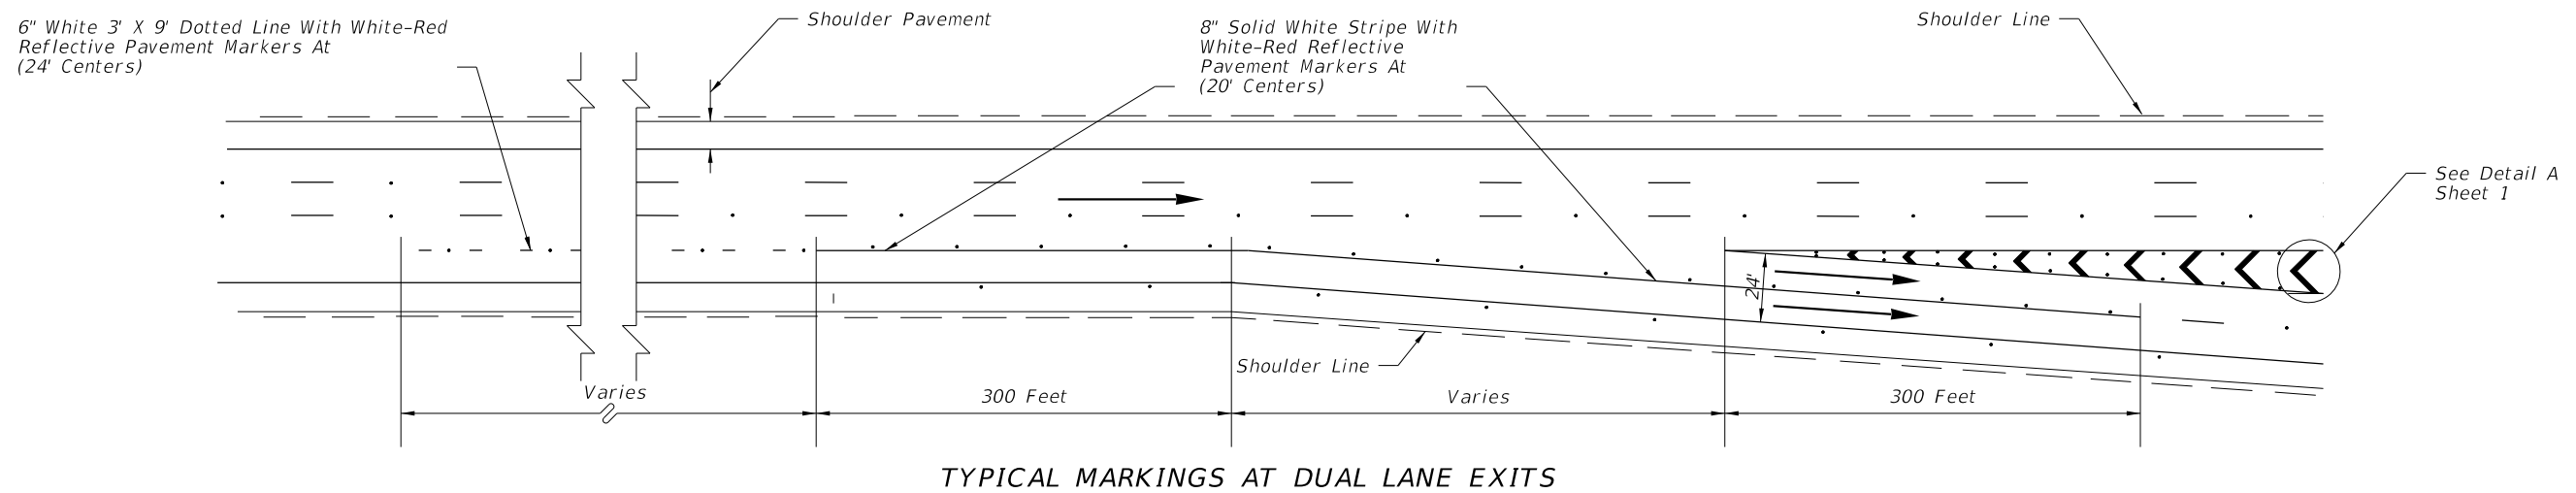
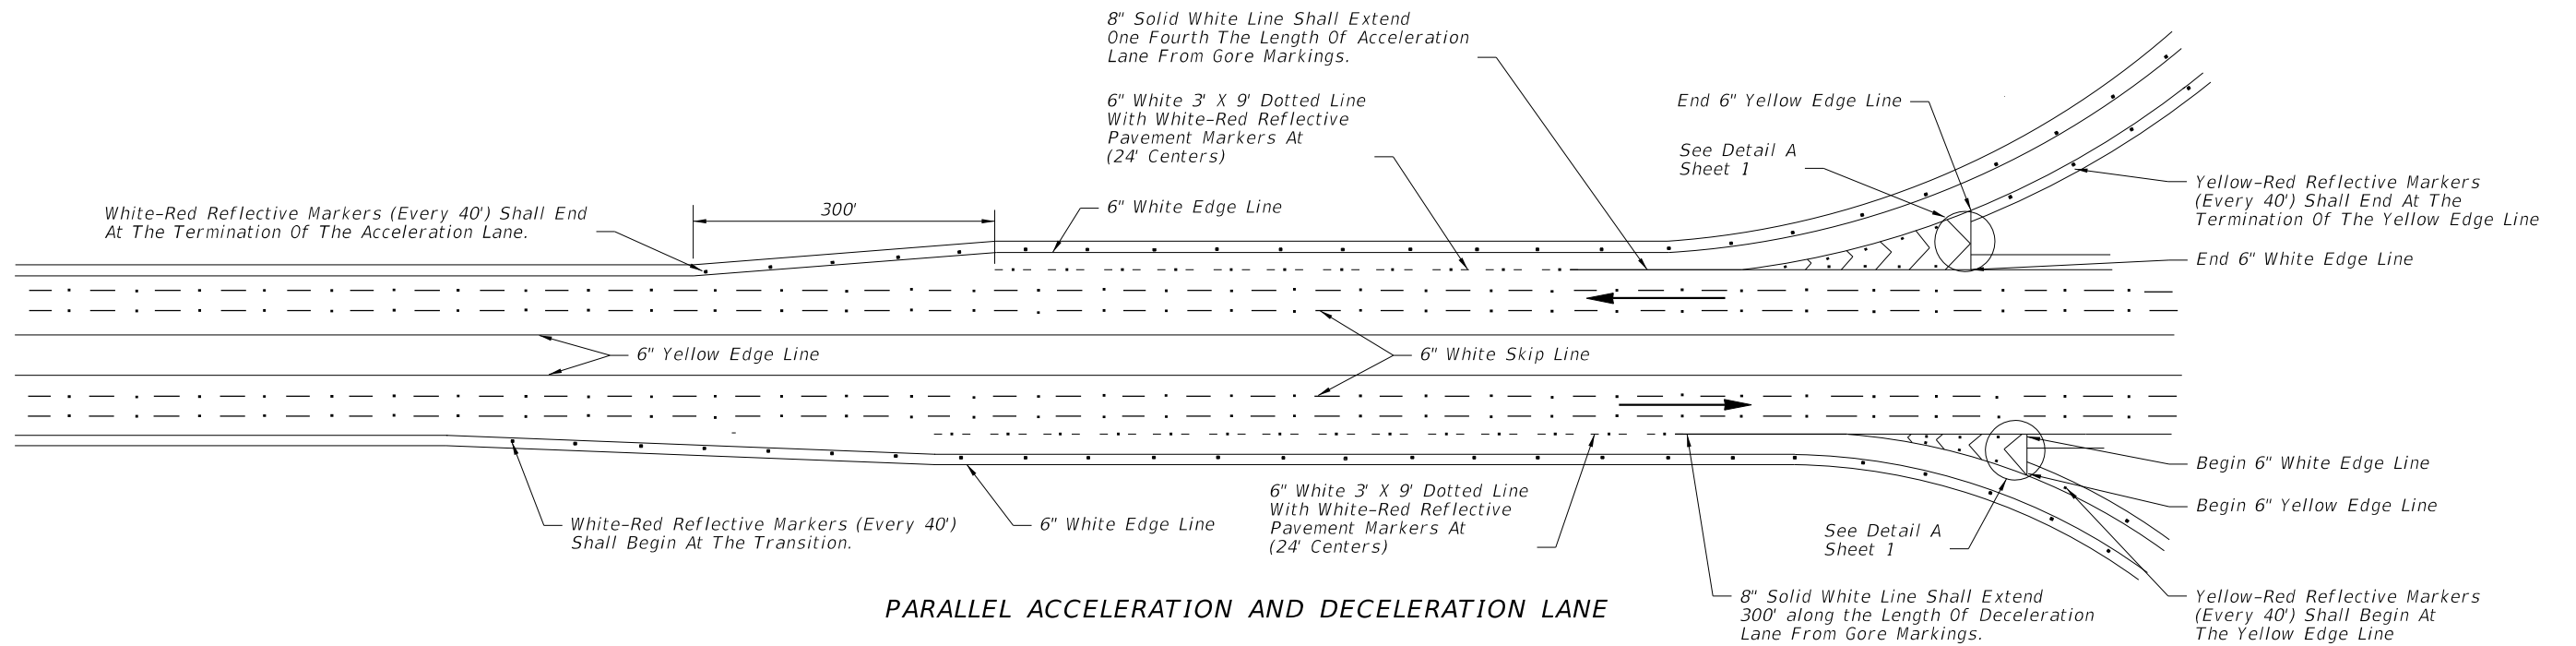


→ Note: Arrows indicate direction of travel and are not shown for pavement marking.

LAST REVISION	DESCRIPTION:	 FDOT DESIGN STANDARDS FY 2012/2013	INTERCHANGE MARKINGS	INDEX NO.	SHEET NO.
07/01/10				17345	3

Notes:

1. Post delineators spaced at 40' on curves of the entrance and exit of ramps. The spacing on the tangent portion of the ramp section shall be 300'. All delineators are to be setback 4' from shoulder break. Post delineators should not be discontinued in sections with guardrail.

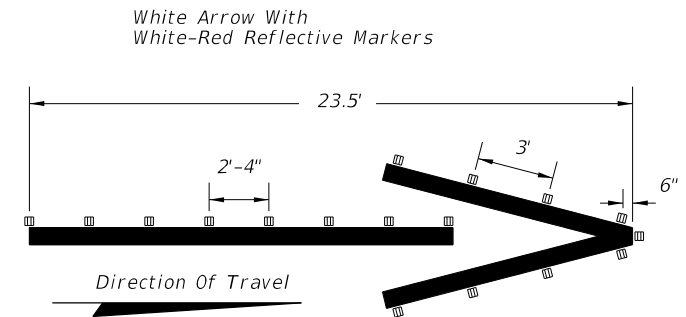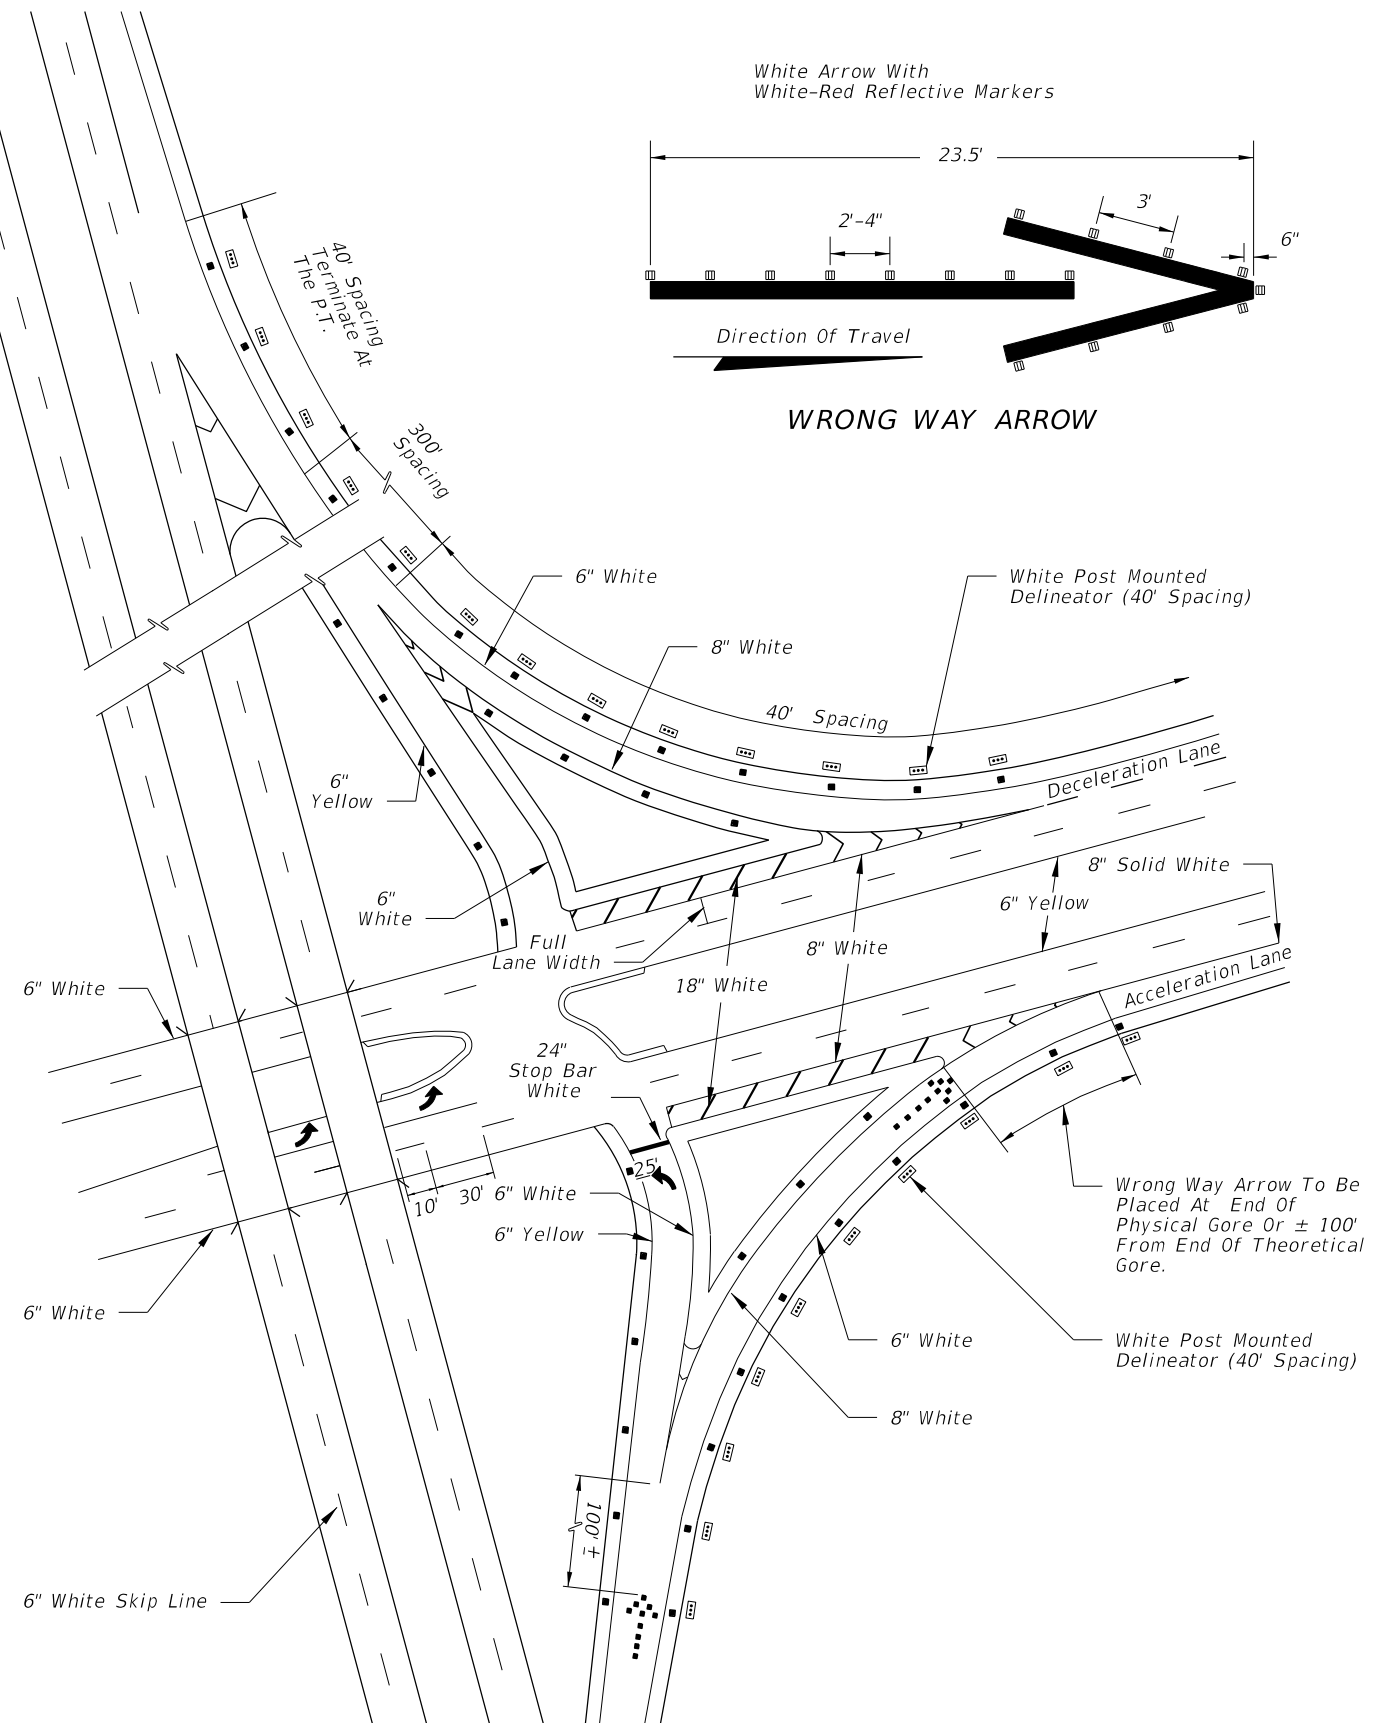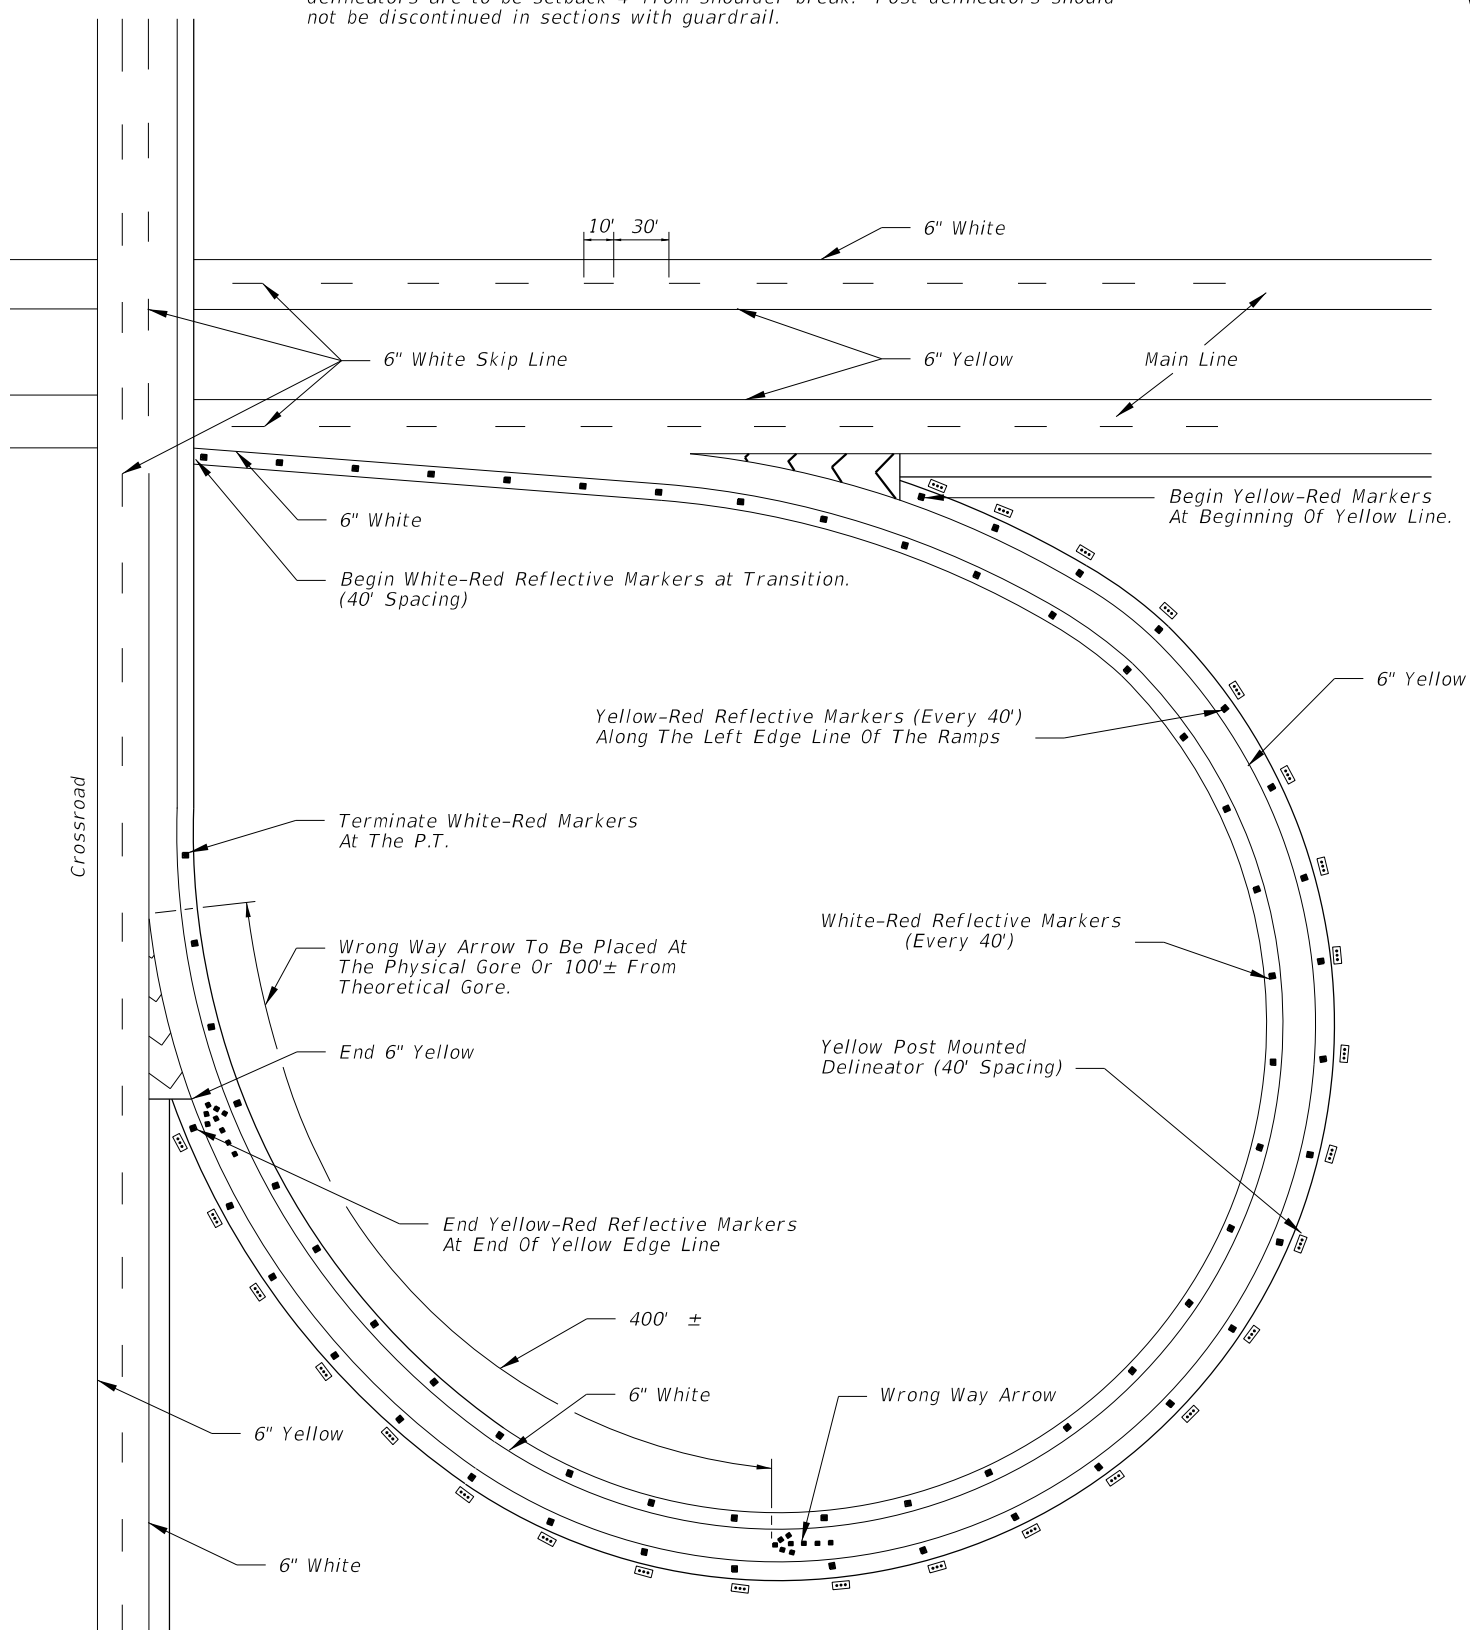

WRONG WAY ARROW

12/30/2011 11:48:34 AM r1960/h C:\projects\standards\roadway\17300-s\17345-04.dgn

LAST REVISION	REVISION	DESCRIPTION:	 FDOT DESIGN STANDARDS FY 2012/2013	INTERCHANGE MARKINGS	INDEX NO.	SHEET NO.
01/01/12					17345	4