

- 1. L = Taper Length
- B = Buffer Length
- X = Work Zone Sign Distance

See Index 102-600 for "L", "B", "X", and channelizing device spacing values.

- 2. If vehicles in a parking zone block the line of sight to TCZ signs, locate and post mount signs in accordance with Index 700-101.
- 3. Use temporary "STOP" sign (R1-1) where the existing stop bar is more than 30' from the taper, remove or cover existing sign.
- 4. The "Speeding Fines Doubled When Workers Present" sign (MOT-13-06) and "End Road Work" Sign (G20-2), along with associated Work Zone Sign Distances, may be omitted when the work operation will be in place for 24 hours or less. Additionally, arrow boards may be omitted when the work operation will be in place for 60 minutes or less and the speed
- 5. If the work area extends across a crosswalk, close the crosswalk in accordance with Index 102-660.
- 6. Dual signs are required for divided roadways.

SYMBOLS:

Work Area


■ Channelizing Device (See Index 102-600)

Work Zone Sign

Type III Barricade

Arrow Board

Lane Identification and Direction of Traffic

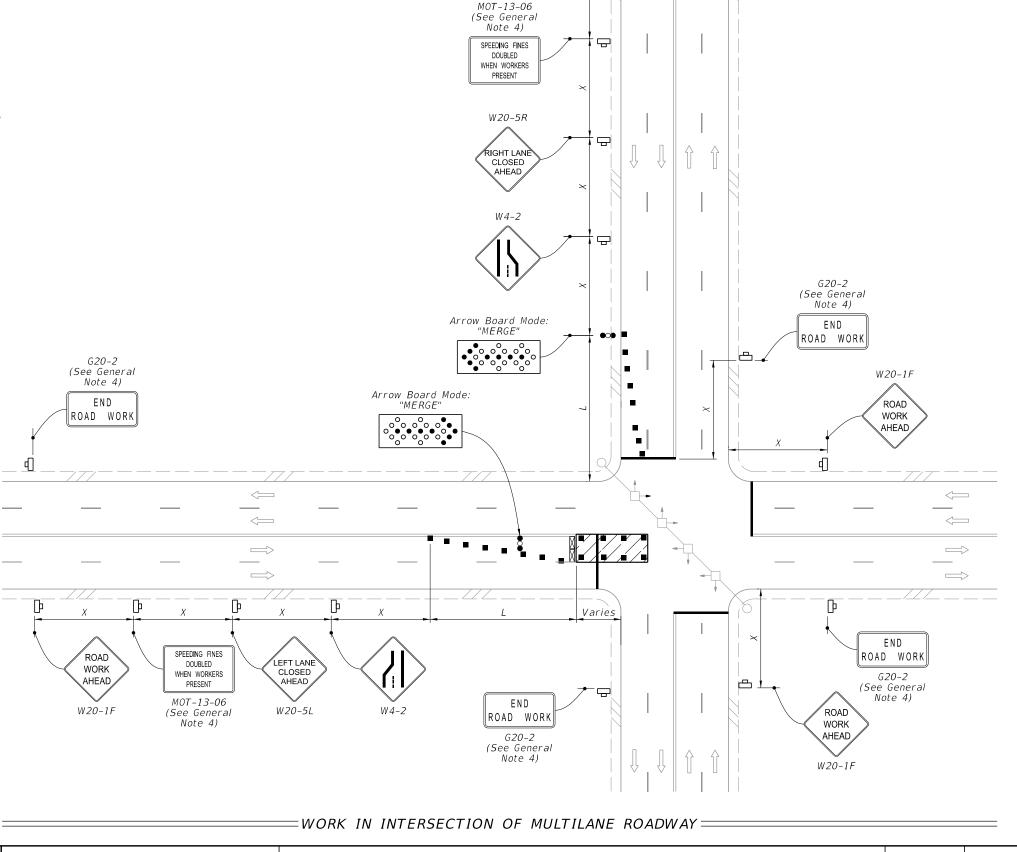


W20-1F


ROAD

WORK

AHEAD

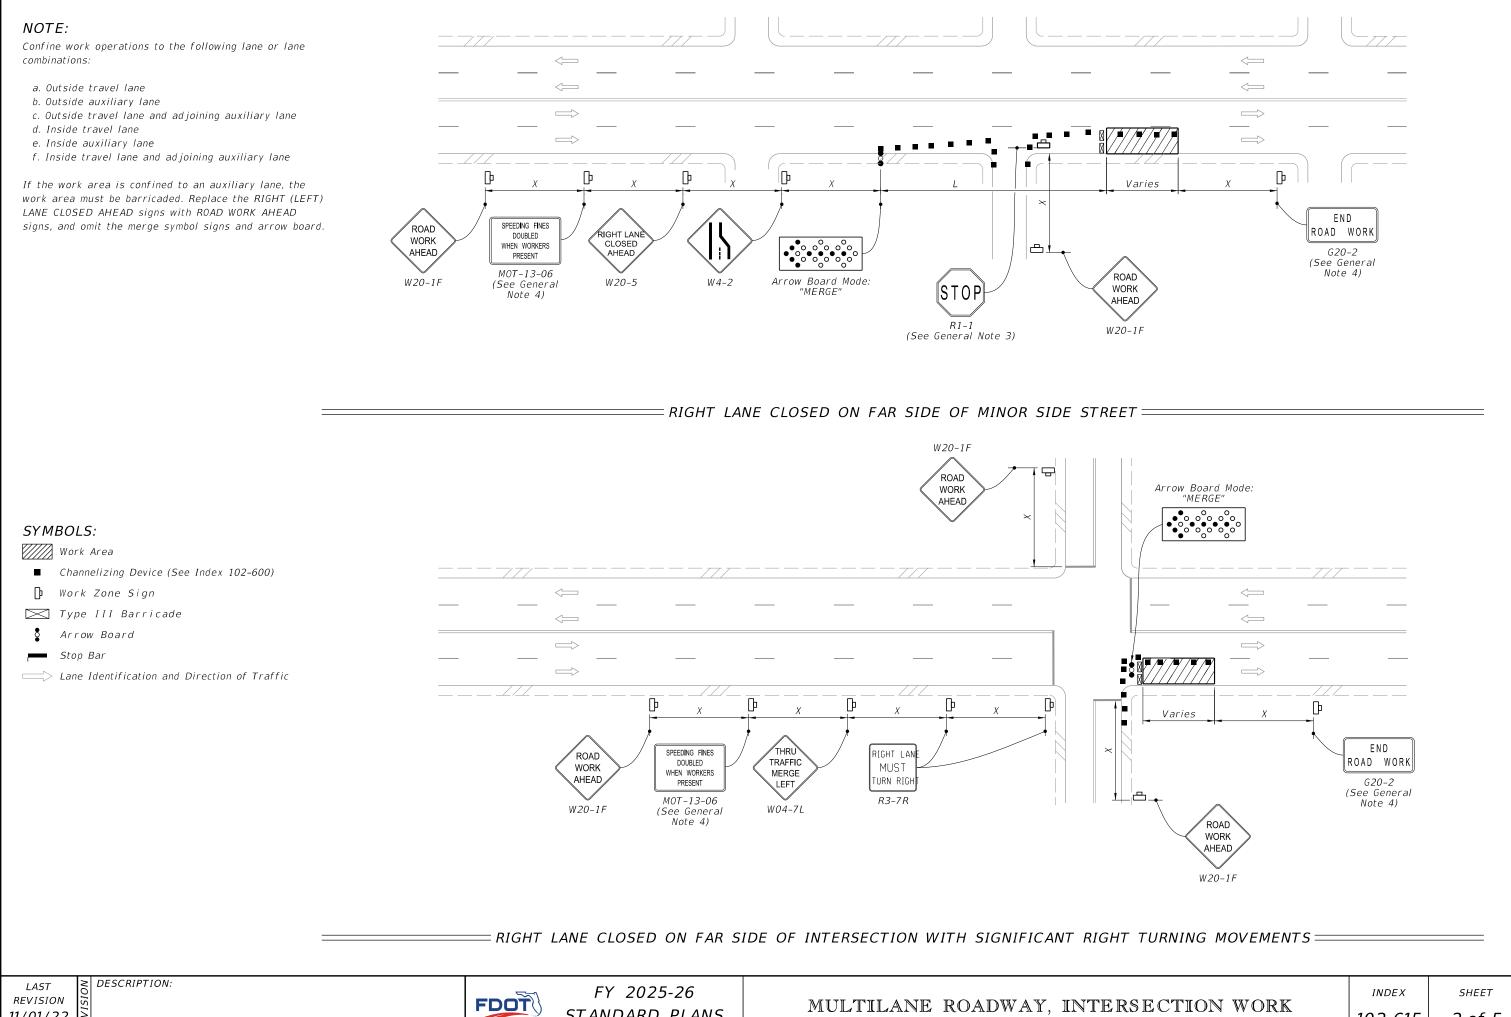

11/01/22

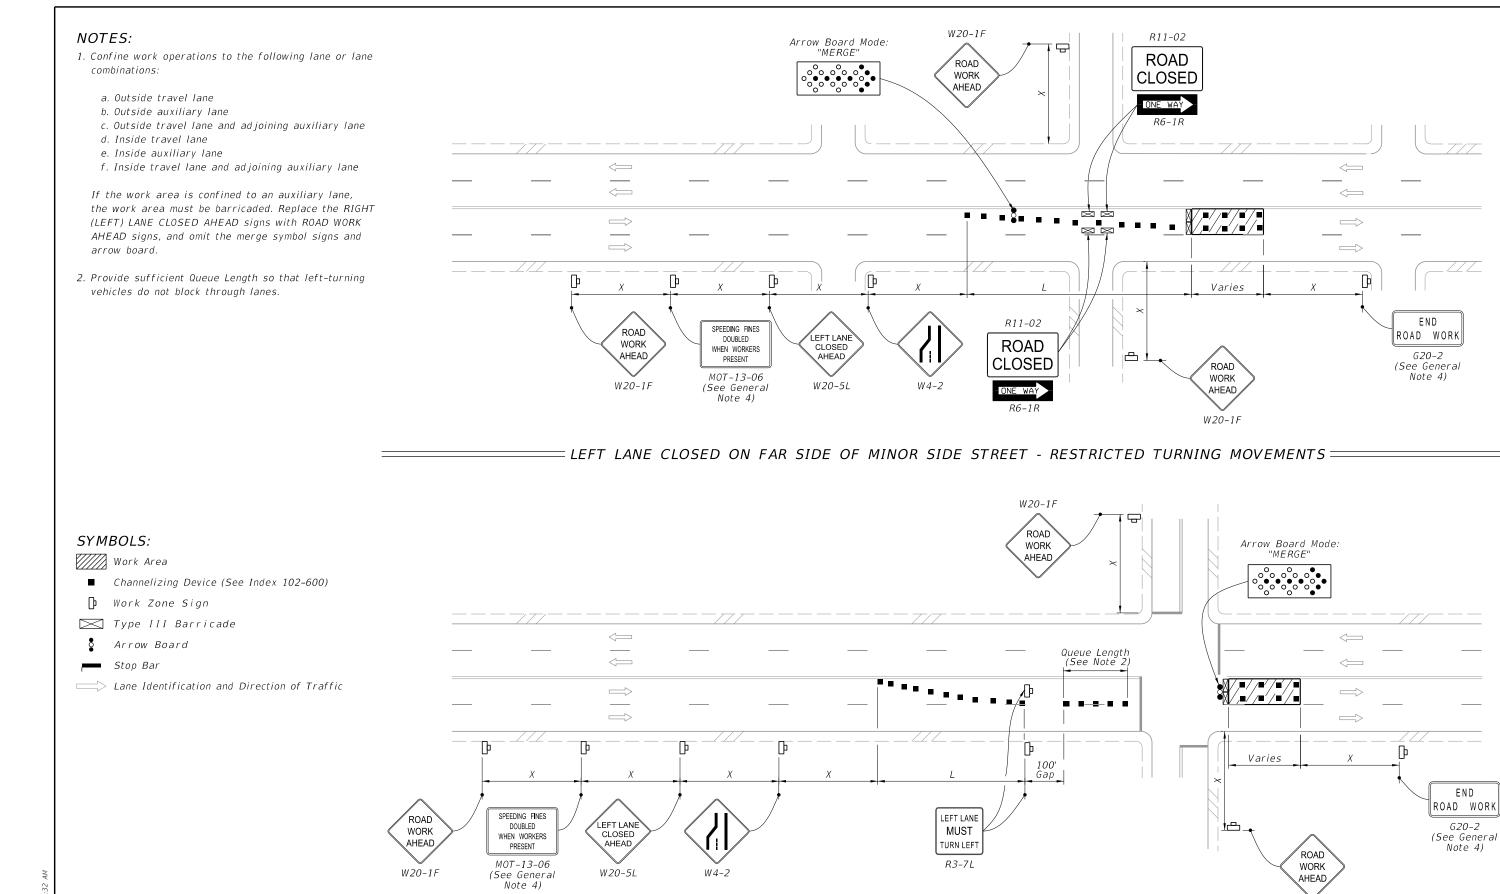

LEFT LANE CLOSED ON FAR SIDE OF INTERSECTION TURNING MOVEMENTS ALLOWED =

REVISION 11/01/22

DESCRIPTION:


FDOT

W20-1F

END

G20-2

Note 4)

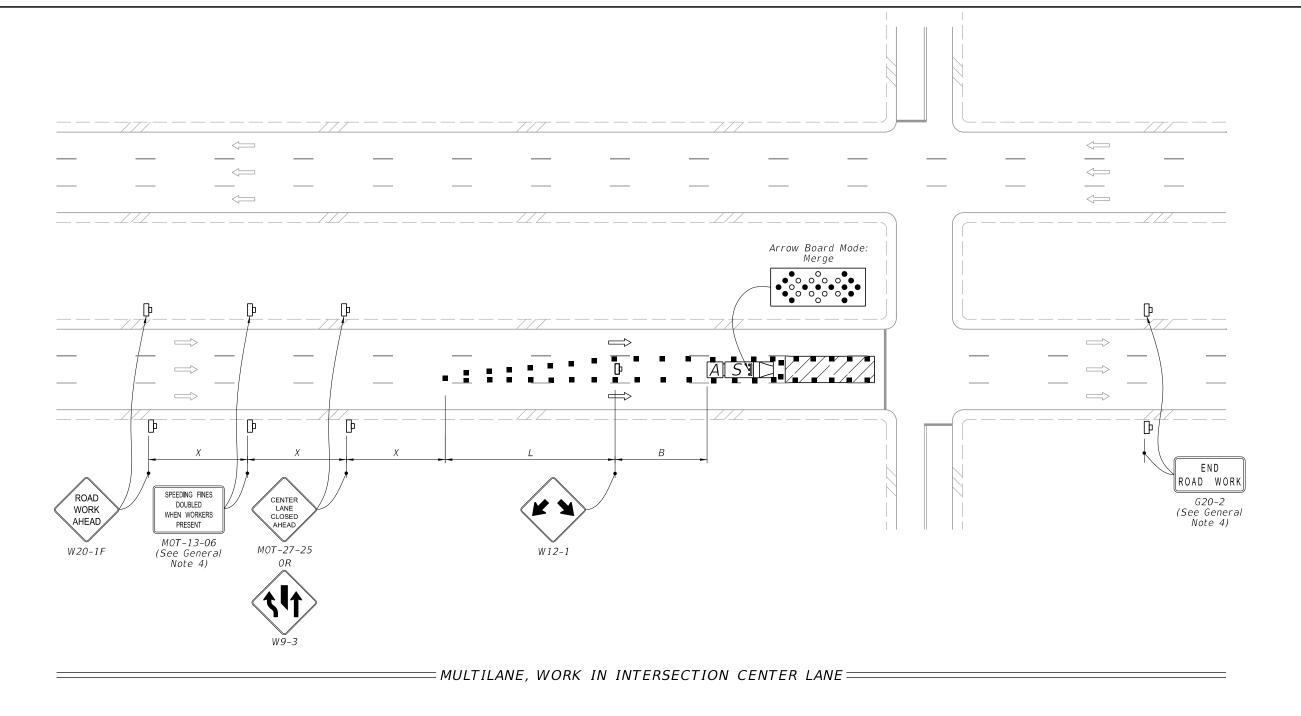

NOTES:

- 1. Confine work operations to one center travel lane and leave the adjacent travel lanes open to traffic.
- 2. Ensure that the merging taper only directs vehicular traffic into either the right or left lane.

SYMBOLS:

Work Area

■ Channelizing Device (See Index 102-600)

₩ork Zone Sign

Type III Barricade

Arrow Board

Stop Bar

Shadow (S) Vehicle With Warning Lights
And Arrow Board

A Truck/Trailer Mounted Attenuator (TMA)


Lane Identification and Direction of Traffic

11:07:

LAST REVISION 11/01/24

DESCRIPTION:



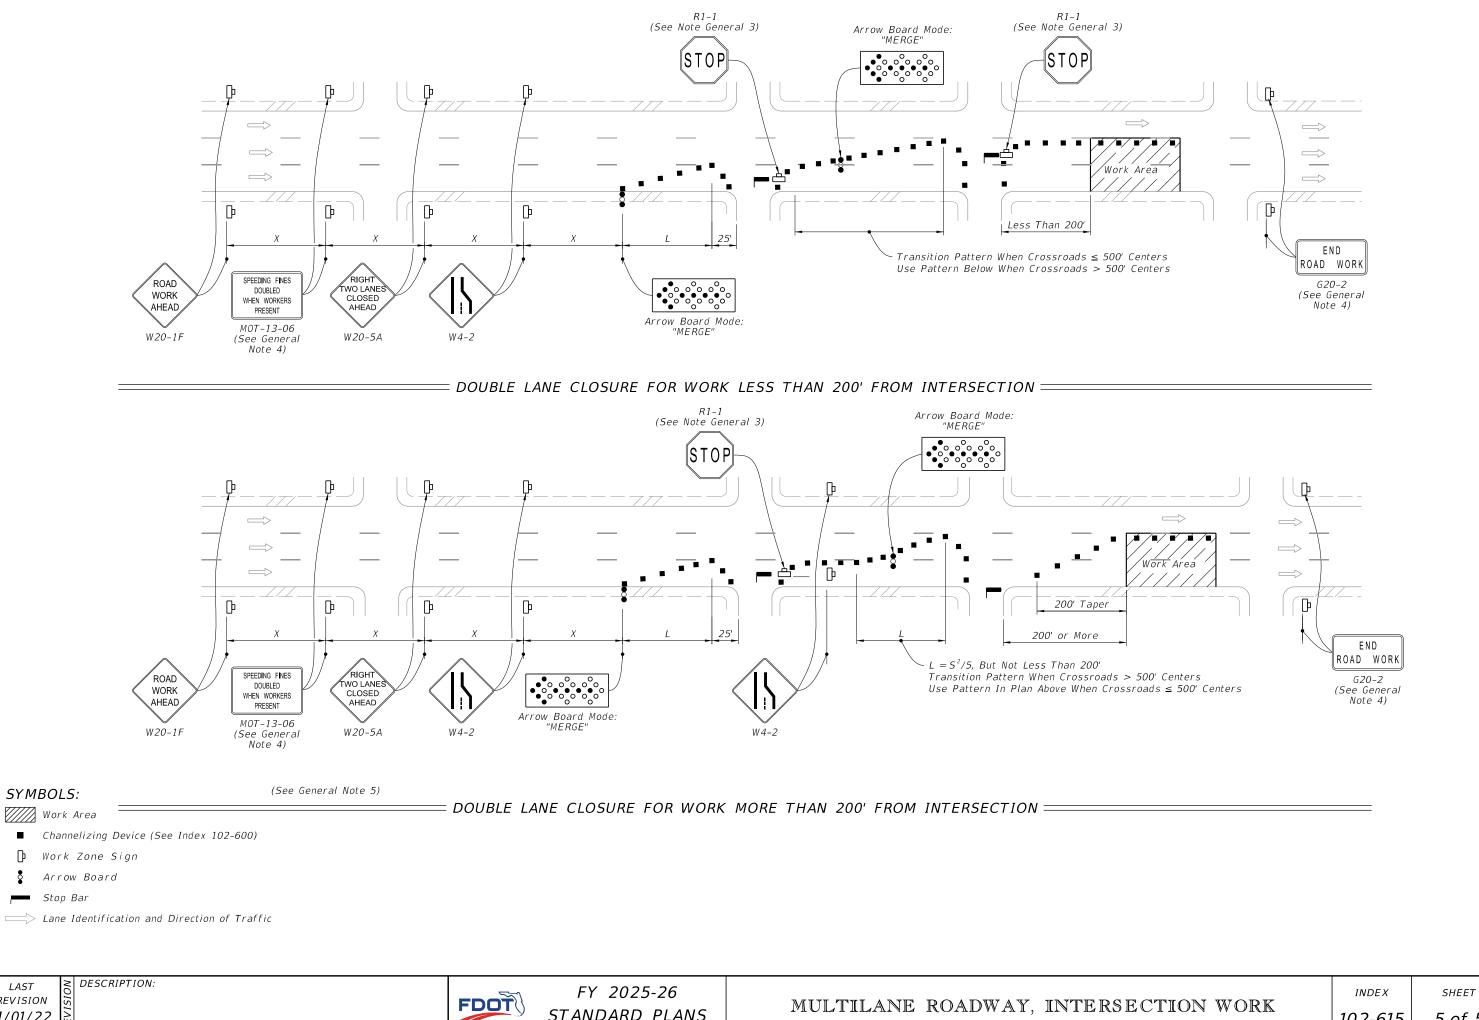

REVISION 11/01/22

SYMBOLS: