



9/29/2026 7:45:45 AM

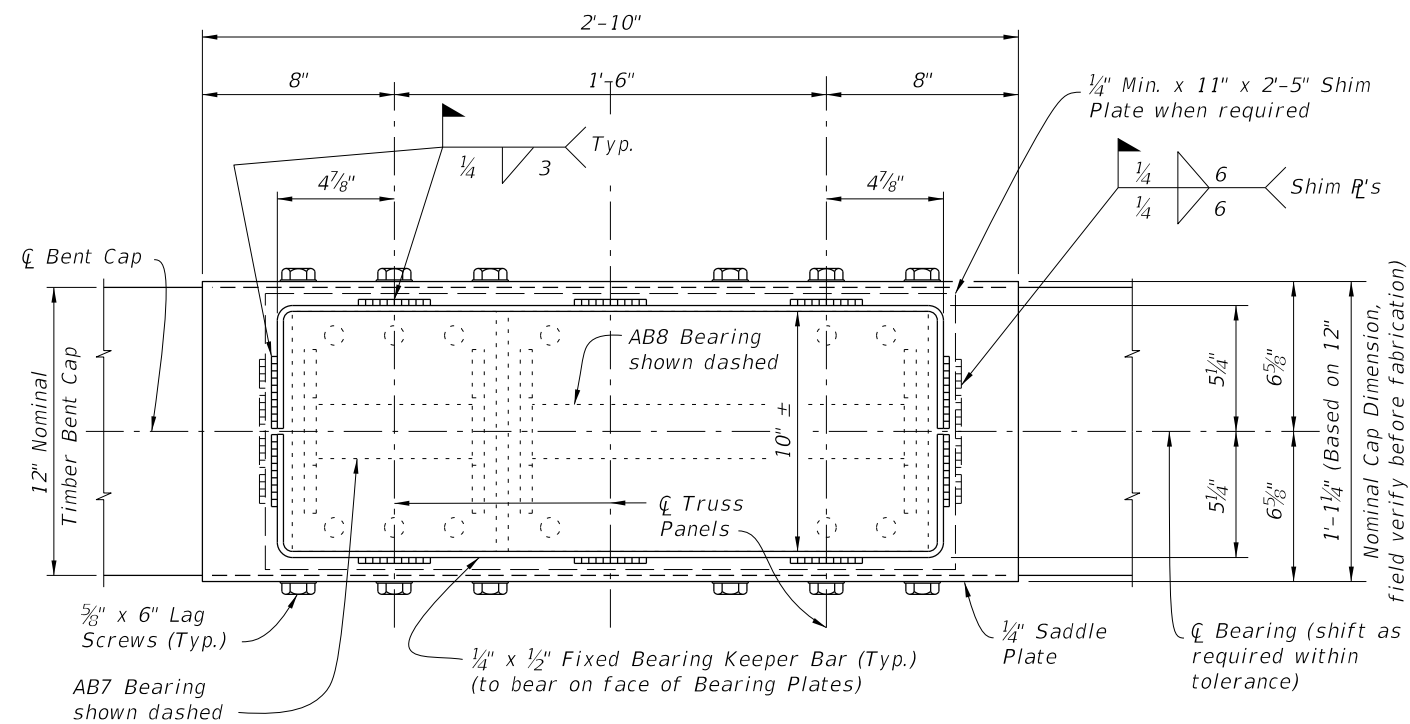


PLAN VIEW

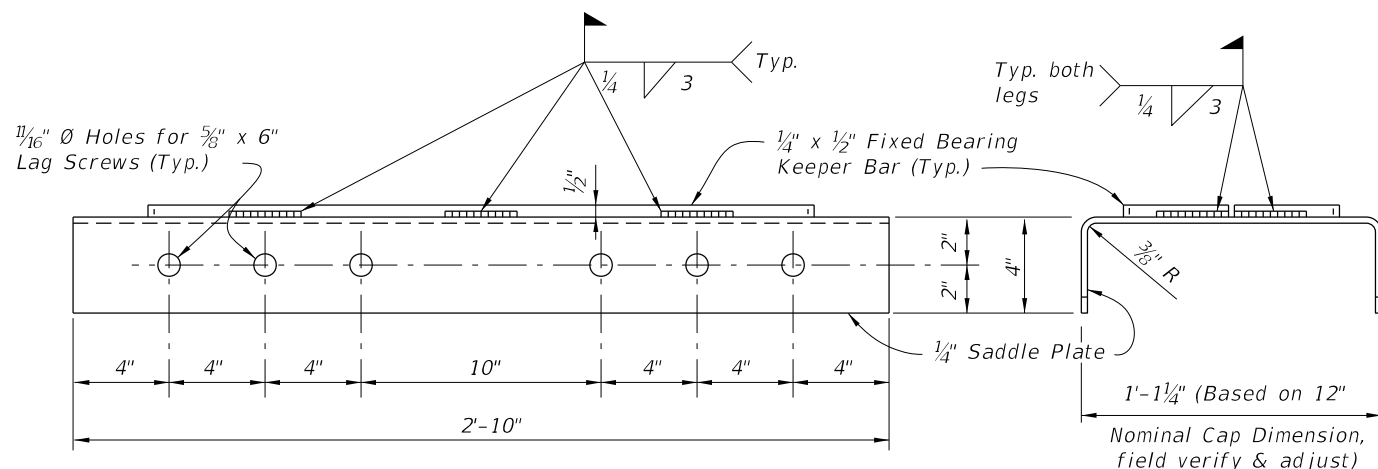


ELEVATION VIEW OF SADDLE PLATE

END VIEW

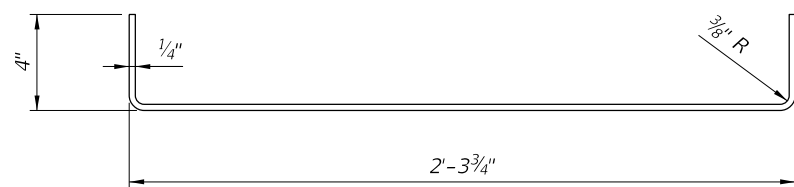


FIXED BEARING KEEPER BAR DETAIL

FIXED BEARING DETAILS

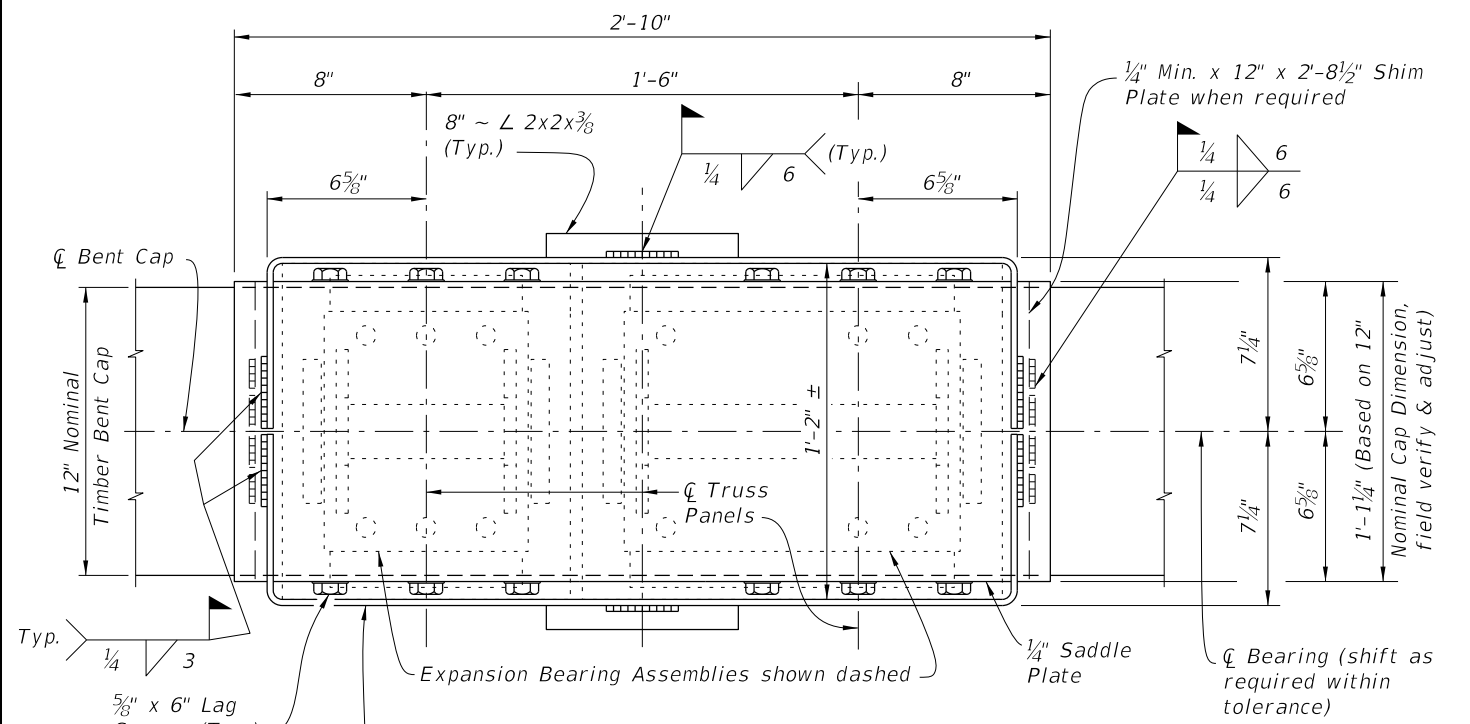


PLAN VIEW

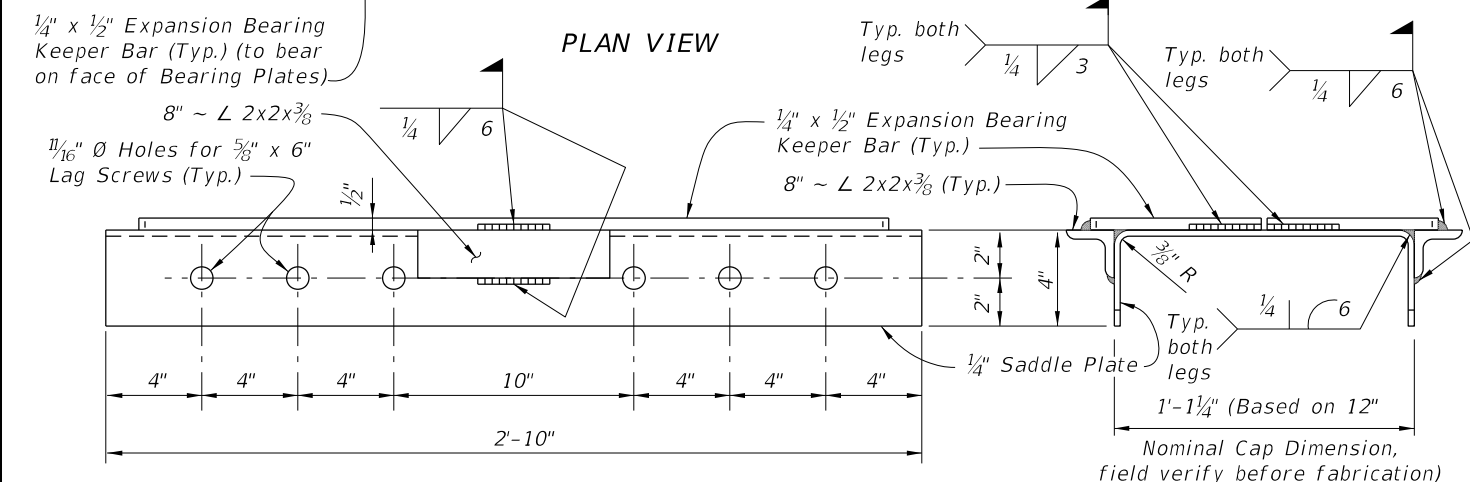

ELEVATION VIEW OF SADDLE PLATE


END VIEW

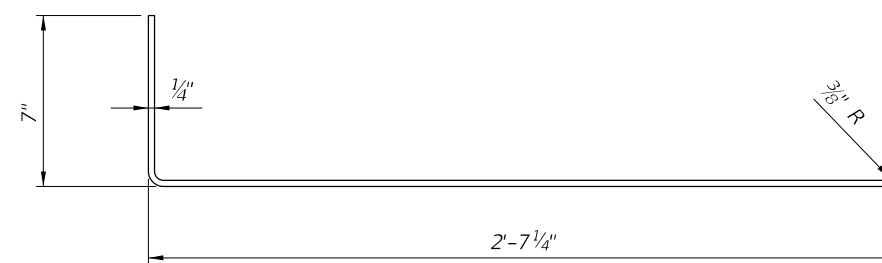


EXPANSION BEARING KEEPER BAR DETAIL

EXPANSION BEARING DETAILS

LAST REVISION 11/01/25	DESCRIPTION:	FDOT FY 2027-28 STANDARD PLANS	TEMPORARY DETOUR BRIDGE TIMBER PILE BACKWALL BENT	INDEX 102-210	SHEET 1 of 3
------------------------------	--------------	--------------------------------------	--	------------------	-----------------

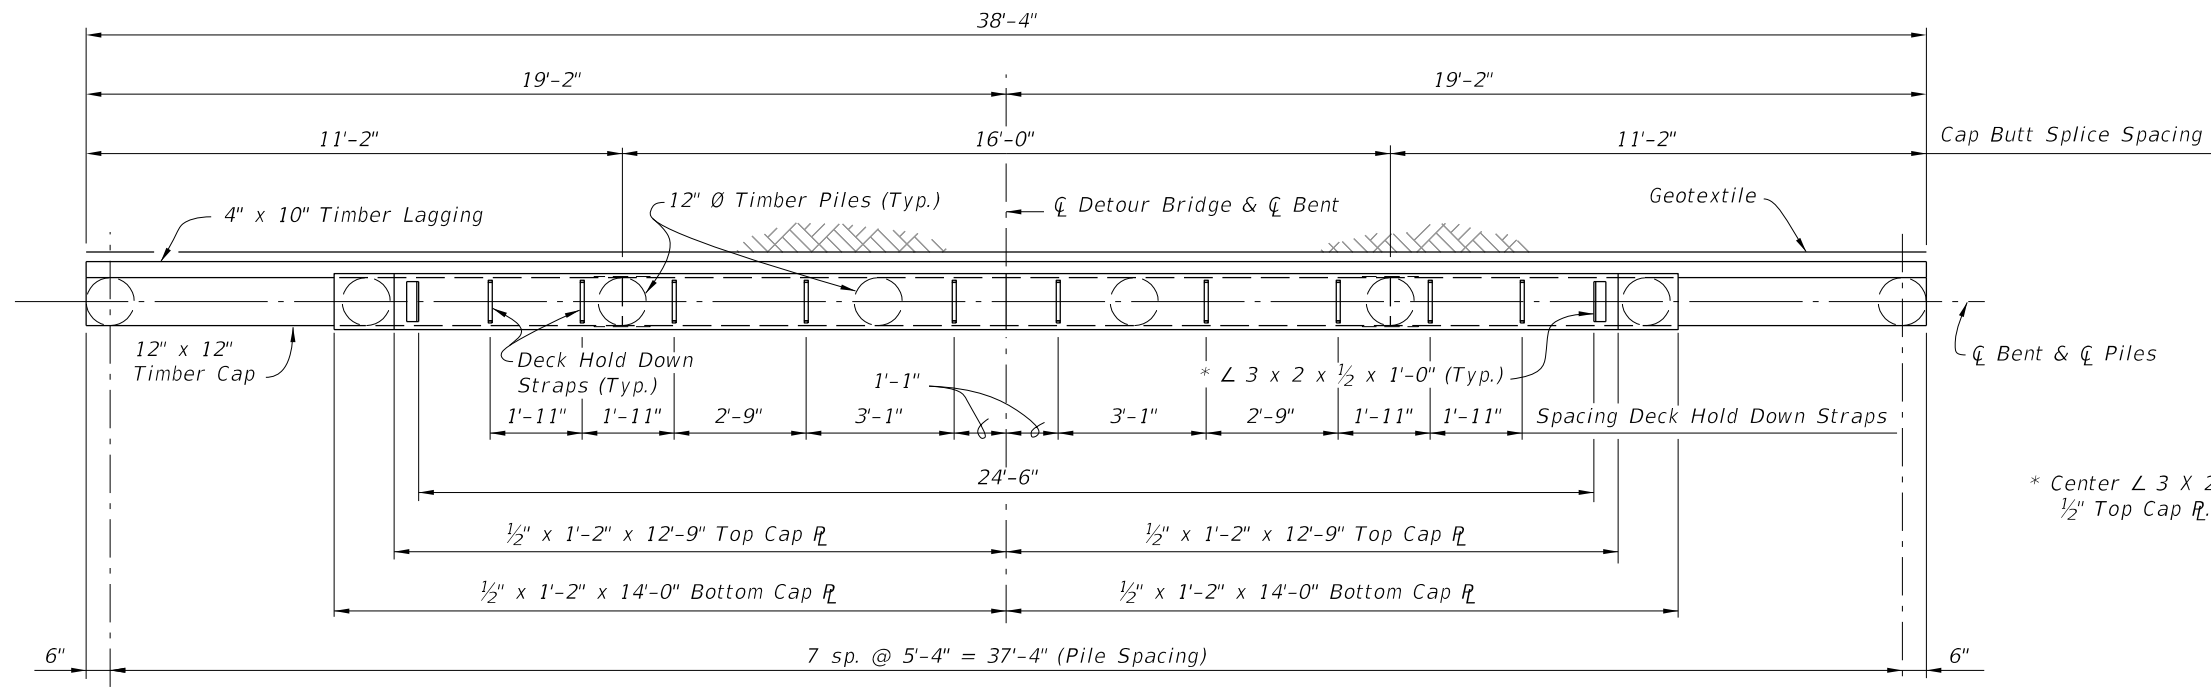

PLAN VIEW

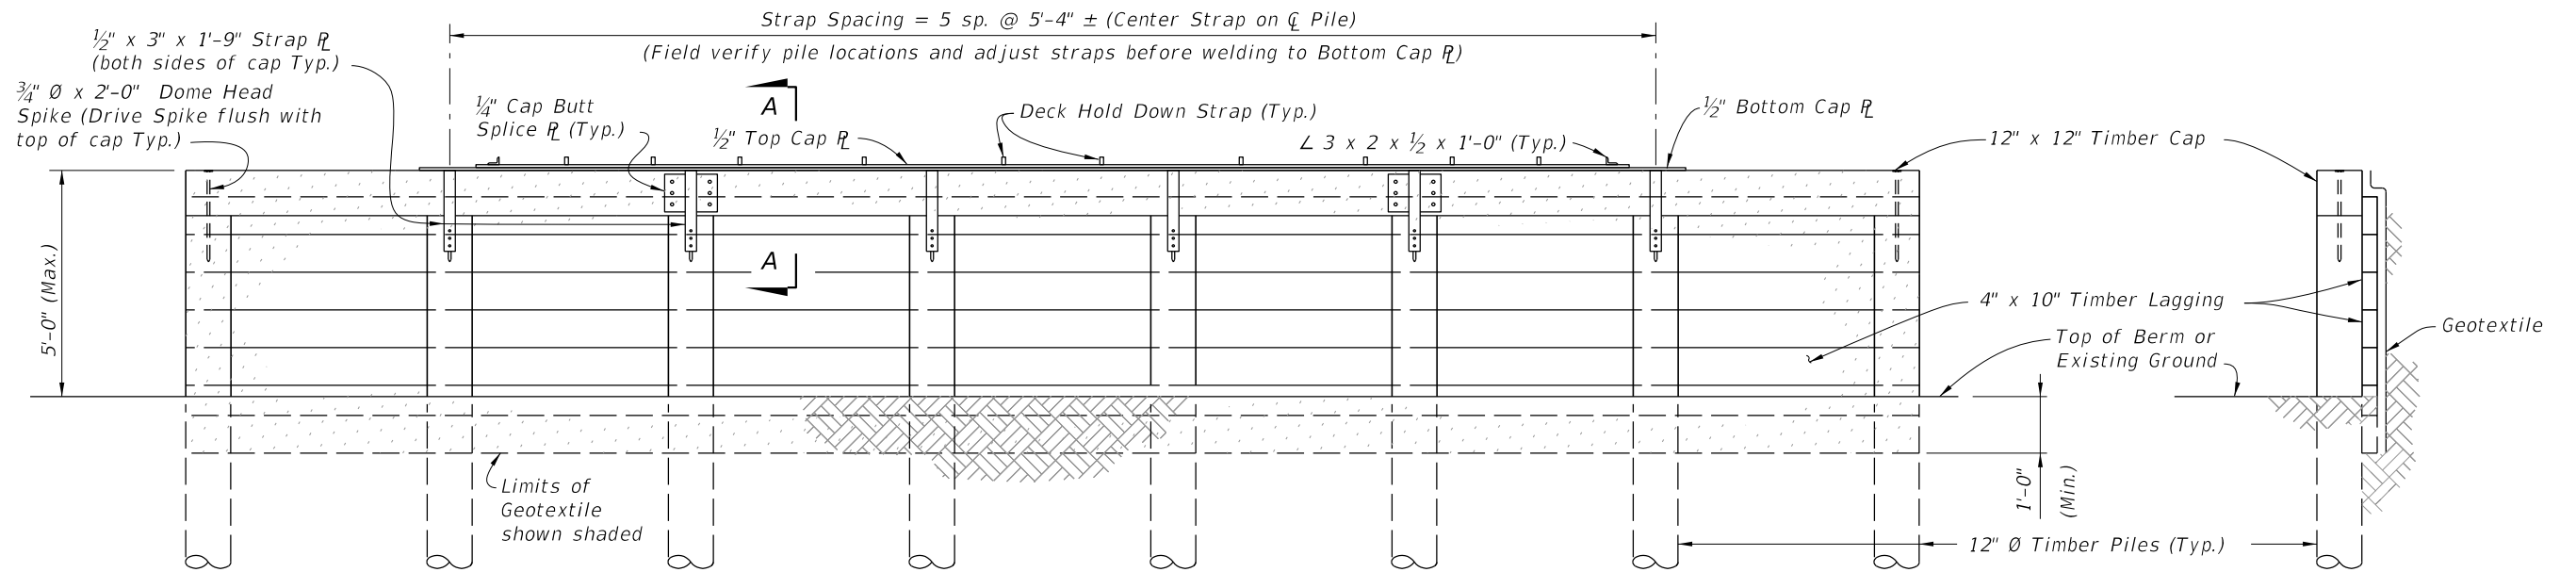


ELEVATION VIEW

END VIEW

BACKWALL BENT DETAILS

LAST REVISION 11/01/25	REVISION	DESCRIPTION:	 FY 2027-28 STANDARD PLANS	TEMPORARY DETOUR BRIDGE TIMBER PILE BACKWALL BENT	INDEX 102-210	SHEET 2 of 3
------------------------------	----------	--------------	--	--	------------------	-----------------


9/29/2026 7:45:50 AM

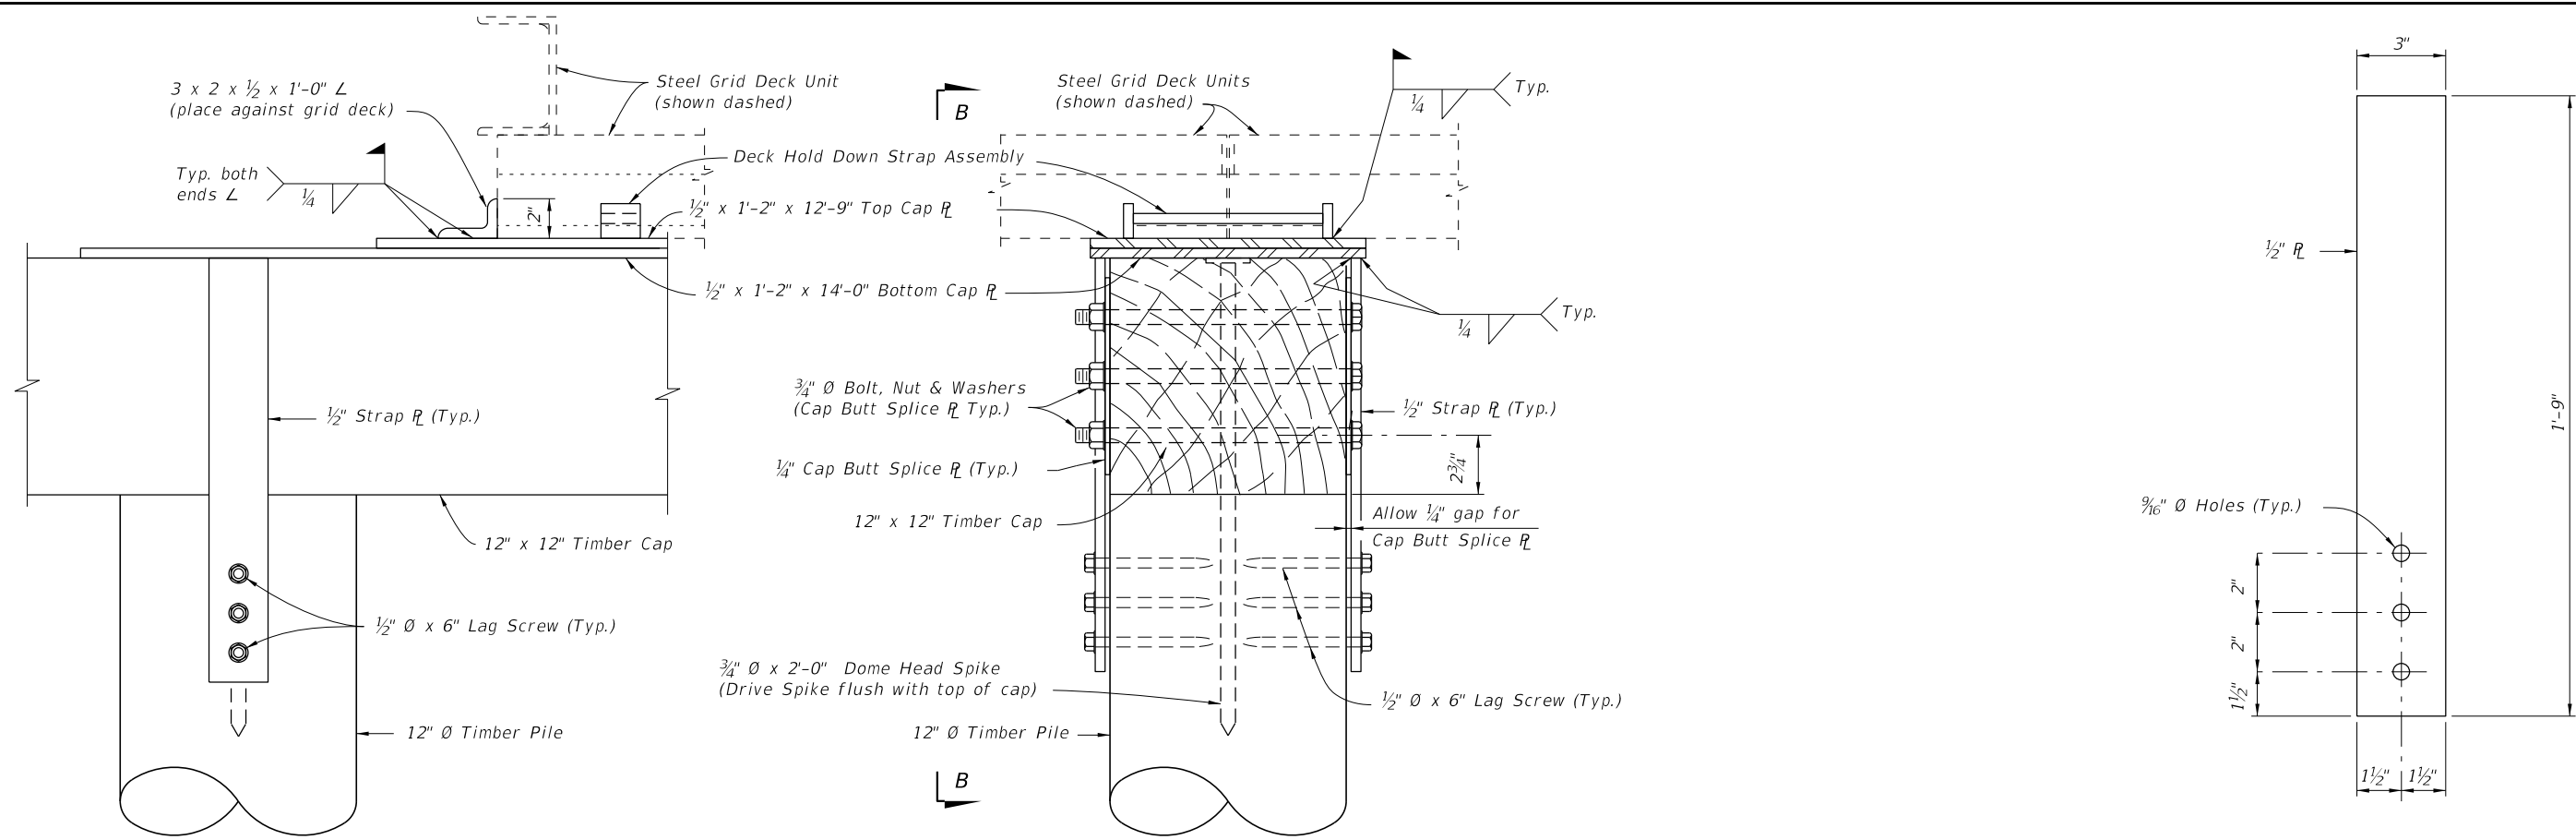


VIEW B-B
(SHOWING END OF CAP PLATES)

SECTION A-A

STRAP PLATE DETAIL

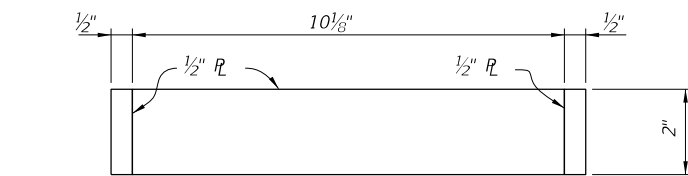


PLAN VIEW

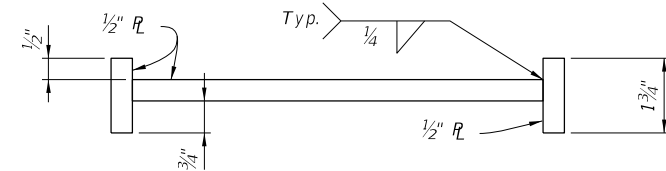

ELEVATION VIEW

HOLD DOWN STRAP ASSEMBLY DETAIL

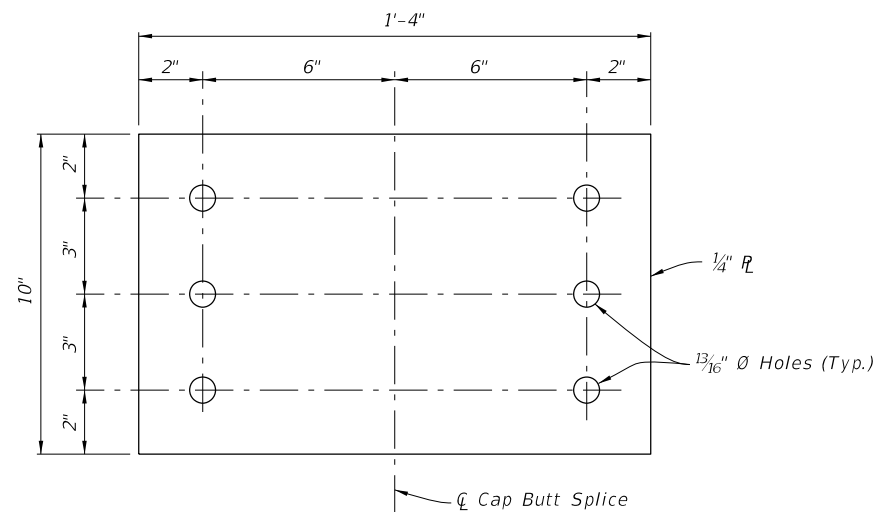

CAP BUTT SPLICE PLATE DETAIL

BACKWALL BENT DETAILS

LAST REVISION 11/01/25	REVISION	DESCRIPTION:	FDOT FY 2027-28 STANDARD PLANS	TEMPORARY DETOUR BRIDGE TIMBER PILE BACKWALL BENT	INDEX 102-210	SHEET 3 of 3
------------------------------	----------	--------------	--------------------------------------	--	------------------	-----------------